

Report ID:	27,565,300	Version:	1
Created:	12 Apr 2026		


Make:	Ford	Model:	Ranger
Body Style:	Utility	Year:	2013
Rego No.:	GTA523	Rego Expiry:	27 Feb 2026
WoF Expiry:	17 Feb 2027	Odometer:	316,673 Kms
Good No.:	27565300	VIN:	MNAUMFF50DW166265
Next Service:	322,255 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

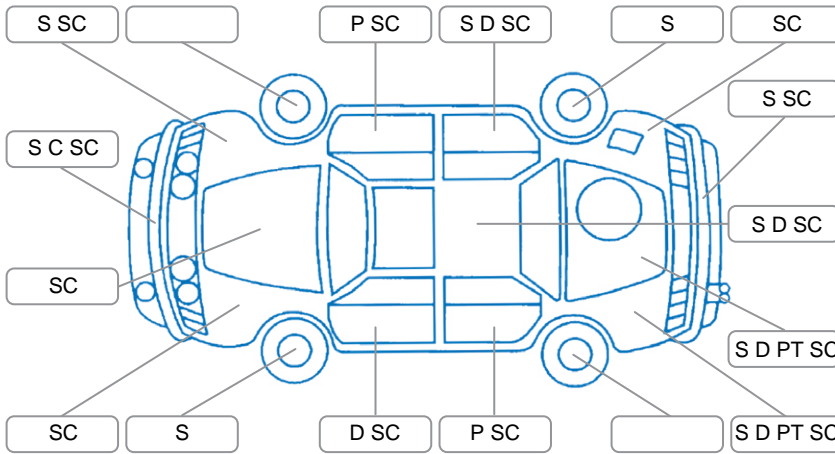

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Bullbar dented. Rolling tonneau cover not closing, roll housing loose.
 RH side mirror cover missing, taped up. Moisture inside indicator repeater.
 Both front sill step plates worn. Towbar tongue in tray.
 All door seals split. Stonechip in windscreen.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Coolant reservoir level below minimum line.

Interior Comments

Seats: Poor, drivers seat base torn, base trim damaged.
 Carpets: Average
 Panels: Average
 Dashboard: Average, steering wheel worn.

General Comments

RF window not going up, stuck down.
 LH side mirror not retracting.
 Park pilot malfunction error when in reverse.
 Sat nav is outdated.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Timing Chain	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No	Kms
Inspected by:	Troy Smith	
Published by:	Troy Smith	
Inspection Date:	12 Apr 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6 mm
Right front			5.5 mm
Left rear			6.5 mm
Right rear			6.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR		✓	
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)	✓		
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____