

Basic Condition Guide

| • | Report ID: | 27,790,343 | Version: | 2 |
|---|------------|-------------|----------|---|
| | Created: | 27 Nov 2025 | | |

| | ОК | Requires Attention | N/A |
|---------------------------------|----------|-----------------------|-------|
| Engine | | | |
| Oil level | V | | |
| Smoke & fumes | V | | |
| Engine performance | V | | |
| Noise | 1 | | |
| Coolant condition | | ~ | |
| Cooling performance | 1 | | |
| Radiator / Hoses (visual) | 1 | | |
| Transmission | | 1 | |
| Operation | ' | | |
| Noise | 1 | | |
| Clutch | 1 | | |
| CV joints | 1 | | |
| Wheel bearings | 1 | 1 | |
| Brakes | | 1 | |
| Performance | 1 | | |
| Hand brake | · | 1 | |
| Tyres (lowest observed tread of | depth of | tyres) | |
| Left front | Ī | • | 7.0 m |
| Right front | | - | 7.0 m |
| Left rear | | - | 7.0 m |
| Right rear | | - | 7.0 m |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | 1 | | |
| Steering performance | 1 | | |
| Shock absorbers | 1 | | |
| Air Conditioning / Heater | | | |
| Operation | | V | |
| Electrical / Accessories | _ | • | |
| Head lights | / | | |
| Tail lights | 1 | | |
| Indicators | ~ | | |
| Dashboard warning lights | 1 | | |
| Wipers (front & rear) | ~ | | |
| Window winder FL | ~ | | |
| Window winder FR | ~ | | |
| Window winder RL | ~ | | |
| Window winder RR | ~ | | |
| Rear view mirrors | - | | |
| Radio (basic test only) | ~ | | |
| CD (basic test only) | | | 1 |
| Number of keys | 1 | | |
| Central locking | 1 | | |
| Remote locking | | | ~ |
| Sat. nav. (basic test only) | | | ~ |
| Reversing camera | | | 1 |


| Make: | Mitsubishi | Model: | Lancer |
|---------------|-------------|------------------|-------------------|
| Body Style: | Sedan | Year: | 1996 |
| Rego No.: | EWQ72 | Rego Expiry: | 24 May 2026 |
| WoF Expiry: | 10 Apr 2026 | Odometer: | 261,955 Kms |
| Good No.: | 27790343 | VIN: | 7A8CJ0D0705011439 |
| Next Service: | 261,000kms | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Kev

| , | | | | |
|-------------|-------------------|--------------|------------------|------------------------|
| S = Scratch | R = Rust | C = Crack | * = Decals | W = Significant scuffs |
| D = Dent | PT = Paint defect | P = Pin dent | SC = Stone Chips | |

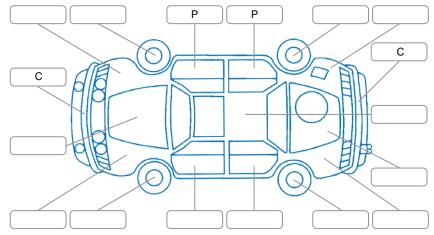

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Right fog light is cracked. Wiper Scratches on windshield. Front and rear lip spoilers are cracked. LVV cert for adjustable suspension. After market muffler & air in take. No wheel centre caps. Bonnet grill is missing rain guard.

| Conditions During Body Inspection | Dry | |
|--|------------|--|
| Under Carriage and Under Bonnet Inspection | n Comments | |

Surface rust is developing on radiator bottom support.

| Interior Comments | | |
|-------------------|---------|--|
| Seats: | Poor | |
| Carpets: | Poor | |
| Panels: | Average | |
| Dashboard: | Good | |

General Comments

Jack and tool are missing. Rear wiper washer is not operating. AC is not cold. AC control panel display is not operating. One key is not matching. Seat trims are showing signs of wear.

| Road Conditions During Test Drive | | Dry | | |
|-----------------------------------|--------------|---------|-------------|-----|
| Engine Timing Mechanism | | Cambelt | | |
| Evidence of Cam Belt Replacement | | Yes | V No | Kms |
| Inspected by: | Yuki Itohara | | | |
| Published by: | Henry Belt | | | |
| Inspection Date: | 18 Nov 2025 | | | |

| have read and understood |
|--------------------------|
| this condition quide |

| NAME | | | |
|------|--|--|--|