

Basic Condition Guide

-	Report ID:	oort ID: 27,793,006		1
	Created:	18 Nov 2025		


Make:	Toyota	Model:	Kluger
Body Style:	Wagon	Year:	2005
Rego No.:	NFE648	Rego Expiry:	22 Jun 2026
WoF Expiry:	24 Sep 2026	Odometer:	200,640 Kms
Good No.:	27793006	VIN:	7AT0H642X20160440
Next Service:	149,192	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

* = Decals W = Significant scuffs S = ScratchR = RustC = CrackD = DentPT = Paint defect P = Pin dentSC = Stone Chips

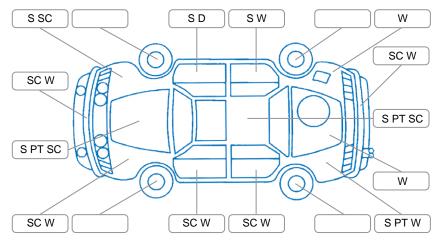

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

RF headlight faded. Central locking & remote not operating drivers door lock and locking/unlocking when driving. Rear fold up seats not bolted in. LF door monsoon shield broken.

Conditions During Body Inspection	Wet	
Under Carriage and Under Bonnet Inspection Comments		

Battery fitted is smaller than original and clamp is spaced with a block of wood. Front brakes below 3mm. Oil leaks - Suspect both rocker cover gasket but there may be other leaks.

Interior Comments			
Seats:	drivers seat ripped.		
Carpets:	Average		
Panels:	Average		
Dashboard: Average			

General Comments

Left wing mirror inoperative. Left rear window winder sticking when closing window. LR

Road Condition	s During Test Drive	Wet		
Engine Timing I	Mechanism	Cambelt		
Evidence of Cam Belt Replacement		✓ Yes	No	105,000 Kms
Inspected by:	Finlay Lemmens			
Published by: Luke Saunders				
Inspection Date:	18 Nov 2025			

Rego lamp inope Recommend wh	erative. LF park lamp eel alignment.	inoperative. Rac	lio not picking ι	up stations.	
Road Condition	s During Test Drive	Wet			
Engine Timing I	Mechanism	Cambelt			
Evidence of Cam Belt Replacement		✓ Yes	No	105,000	Kms
Inspected by:	Finlay Lemmens				
Published by:	Luke Saunders				
Inspection Date: 18 Nov 2025					
have read and u his condition gui					

	ОК	Requires Attention	N/A
Engine			
Oil level	/		
Smoke & fumes	✓		
Engine performance	V		
Noise	V		
Coolant condition	/		
Cooling performance	~		
Radiator / Hoses (visual)	/		
Transmission			
Operation	/		
Noise	/		
Clutch			~
CV joints	/		
Wheel bearings	/		
Brakes			
Performance	/		
Hand brake	/		
Tyres (lowest observed tread d	epth of	tyres)	
Left front			5.0 mm
Right front			5.0 mm
Left rear		3	3.0 mm
Right rear		4	1.0 mm
Spare	Yes		
Suspension			
Suspension performance	/		
Steering performance		V	
Shock absorbers	/		
Air Conditioning / Heater			
Operation	/		
Electrical / Accessories			
Head lights		V	
Tail lights		V	
Indicators	/		
Dashboard warning lights	/		
Wipers (front & rear)	/		
Window winder FL	\(\tau \)		
Window winder FR	/		
Window winder RL		V	
Window winder RR	/		
Rear view mirrors		V	
Radio (basic test only)		~	
CD (basic test only)		V	
Number of keys	1		
Central locking		/	
Remote locking		V	
Sat. nav. (basic test only)			V
Reversing camera	/		

ve read and understood			
condition guide:	NAME	SIG	INATURE