

Report ID:	27,797,285	Version:	1
Created:	29 Nov 2025		


Make:	Toyota	Model:	Hilux
Body Style:	Utility	Year:	1999
Rego No.:	XY2949	Rego Expiry:	26 Jan 2026
WoF Expiry:	25 Jan 2026	Odometer:	602,152 Kms
Good No.:	27797285	VIN:	JT732LNF200001025
Next Service:	611,000 km	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

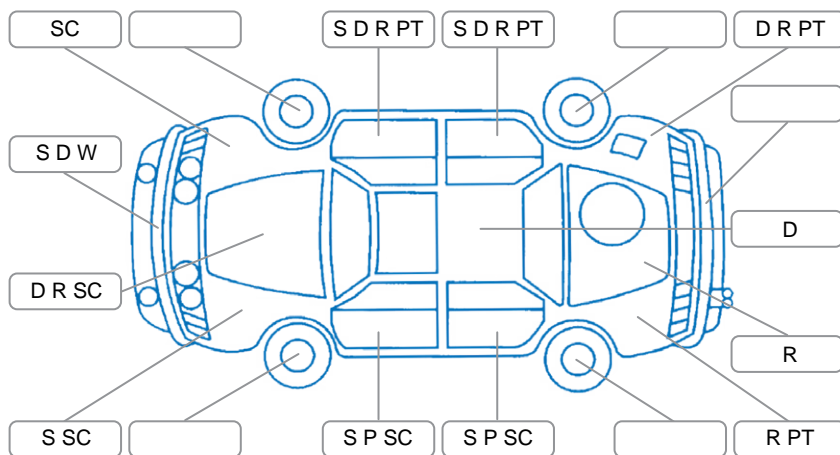

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Front indicator lens loose, R/H inner sill rusty, rear tray rusty, locking pin for tailgate broken, L/R tail light cracked, wing mirror caps missing, Windscreen chip out of cva,

Conditions During Body Inspection

Under Carriage and Under Bonnet Inspection Comments

RWD. Excessive oil leaks underside, Excessive rust underside, Both front tyres have vertical play, L/F tyre outer edge worn, R/R tread pattern middle split,

Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Average
Dashboard:	Average

General Comments

R/F wing mirror glass cracked, R/F headlight not working,

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 423,772 Kms
Inspected by:	Imraan Bryant
Published by:	Erin White
Inspection Date:	27 Nov 2025

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.0 mm
Right front			6.0 mm
Left rear			2.0 mm
Right rear			2.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	1		
Central locking			✓
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____