

Report ID:	27,798,557	Version:	2
Created:	21 Nov 2025		


Make:	Holden	Model:	Cruze
Body Style:	Wagon	Year:	2017
Rego No.:	KYU598	Rego Expiry:	19 Mar 2026
WoF Expiry:	27 Jun 2026	Odometer:	167,263 Kms
Good No.:	27798557	VIN:	KL3JA35MJGK353112
Next Service:	162000 kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

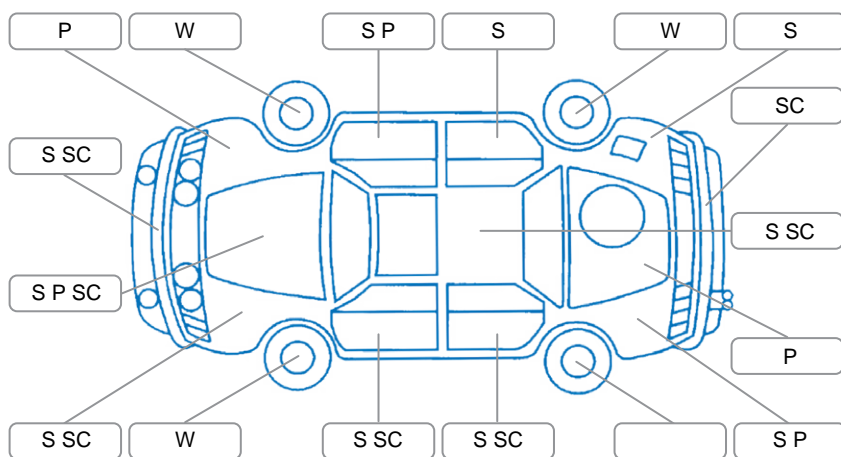

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Coolant low, engine oil leak, windscreen cracked, service overdue, RF sun visor broken, LF mirror repeater cracked, LR door seal torn,

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Rear bumper support damaged.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Poor
Dashboard:	Average

General Comments

Engine ticking noise on idle, RR inner guard crack, engine oil leak, Rear bumper support damaged,

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Will Dewey
Published by:	Henry Manders
Inspection Date:	20 Nov 2025

I have read and understood this condition guide:

NAME _____

SIGNATURE _____

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.0 mm
Right front			3.0 mm
Left rear			7.0 mm
Right rear			5.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓