

Report ID:	27,807,568	Version:	1
Created:	04 Dec 2025		


Make:	Subaru	Model:	Forester
Body Style:	Wagon	Year:	2008
Rego No.:	NSS940	Rego Expiry:	19 Mar 2025
WoF Expiry:	03 Dec 2026	Odometer:	96,556 Kms
Good No.:	27807568	VIN:	7AT0GF17X20024766
Next Service:	105,000	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

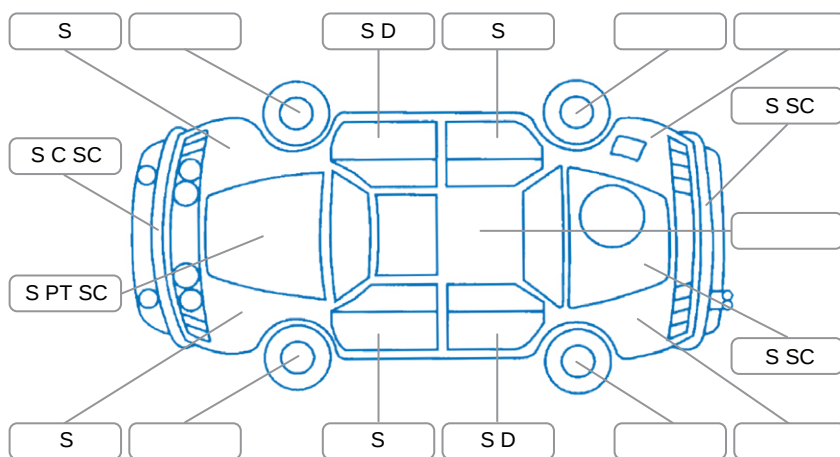

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Floor structure repair evident.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Has got recent WOF - but noted as needing attention soon : Brake performance excessive wear and rusted Both front wheel bearing deteriorating. All brake calliper rust. Lhf sway bar link play requires attention soon. All suspension rust requires attention soon

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Radio nw

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☐ Yes ☒ No Kms
Inspected by:	Gary Adams
Published by:	Anna Zandstra
Inspection Date:	25 Nov 2025

I have read and understood this condition guide:

NAME _____

SIGNATURE _____

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance		✓	
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.0 mm
Right front			5.0 mm
Left rear			8.0 mm
Right rear			6.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓