

# **Basic Condition Guide**

•	Report ID:	27,808,714	Version:	3
	Created:	30 Nov 2025		

Requires


Make:	Skoda	Model:	Octavia
Body Style:	Wagon	Year:	2016
Rego No.:	JPZ828	Rego Expiry:	02 Feb 2026
WoF Expiry:	10 Dec 2025	Odometer:	106,310 Kms
Good No.:	27808714	VIN:	TMBKJ7NE0G0057635
Next Service:	118,000km	Service History:	Yes

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Kev

,				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

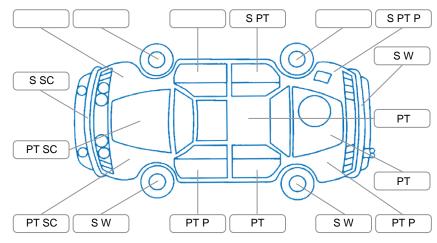

Note: some defects and blemishes may not be displayed in the diagram

## **Body Inspection Comments**

Black overspray on the majority of exterior panels.

Conditions During Body Inspection	Dry
Under Carriage and Under Bonnet Inspection Comm	ents

## Some oil seepage around turbo.

LF tyre tread depth is below legal minimum for a WOF.

Both front tyres are worn on the inside shoulder.

Interior Comm	ents
Seats:	Good
Carpets:	Good
Panels:	Good, cargo blind is missing.
Dashboard: Good	

### **General Comments**

Mirror adjustment switch on drivers door is loose.

Warning message flashes up on dash occasionally when taking off but not for long enough to read what it says.

Road Conditions During Test Drive		Dry		
Engine Timing Mechanism		Cambelt		
Evidence of Cam Belt Replacement		<b>✓</b> Yes	No	97,983 Kms
Inspected by:	Blair Robertson			
Published by:	Shane Charlton			
Inspection Date:	24 Nov 2025			

I have read and understood
this condition guide:

NAME			

	UK	Attention	IN/A
Engine			1
Oil level	/		
Smoke & fumes	<b>✓</b>		
Engine performance	/		
Noise	<b>V</b>		
Coolant condition			
Cooling performance	<b>/</b>		
Radiator / Hoses (visual)	<b>/</b>		
Transmission			
Operation	<b>✓</b>		
Noise	<b>/</b>		
Clutch			<b>'</b>
CV joints	/		
Wheel bearings	/		
Brakes			
Performance	>		
Hand brake	/		
Tyres (lowest observed tread d	epth of	tyres)	
Left front		,	1.0 mm
Right front		2	2.0 mm
Left rear		(	3.0 mm
Right rear		(	3.0 mm
Spare	Yes		
Suspension			
Suspension performance	/		
Steering performance	/		
Shock absorbers	<b>/</b>		
Air Conditioning / Heater			
Operation	<b>/</b>		
Electrical / Accessories			
Head lights	<b>✓</b>		
Tail lights	<b>/</b>		
Indicators	/		
Dashboard warning lights		•	
Wipers (front & rear)	/		
Window winder FL	<b>/</b>		
Window winder FR	\( \tau \)		
Window winder RL	<b>✓</b>		
Window winder RR	<b>/</b>		
Rear view mirrors	/		
Radio (basic test only)	/		
CD (basic test only)			<b>'</b>
Number of keys	2		
Central locking	/		
Remote locking	/		
Sat. nav. (basic test only)			~
Reversing camera			~

SIGNATURE		