

Report ID:	27,812,335	Version:	2
Created:	10 Dec 2025		


	ОК	Requires Attention	N/A
Engine	<u> </u>	7 (CCC) (CC)	14,71
Oil level	1		
Smoke & fumes	1		
Engine performance	1		
Noise	1		
Coolant condition	1		
Cooling performance	1		
Radiator / Hoses (visual)	1		
Transmission			
Operation	~		
Noise	1		
Clutch			~
CV joints	/		
Wheel bearings	'		
Brakes			
Performance	1		
Hand brake	/		
Tyres (lowest observed tread d	epth of	tyres)	
Left front		7	7.3 mm
Right front		7	7.9 mm
Left rear		6	6.9 mm
Right rear		8	3.4 mm
Spare	Yes		
Suspension			
Suspension performance	•		
Steering performance	~		
Shock absorbers	'		
Air Conditioning / Heater			
Operation	•		
Electrical / Accessories	1		
Head lights	•		
Tail lights	•		
Indicators	•		
Dashboard warning lights	~		
Wipers (front & rear)	•		
Window winder FL	•		
Window winder FR	•		
Window winder RL	/		
Window winder RR	•		
Rear view mirrors	•		
Radio (basic test only)	•		
CD (basic test only)			
Number of keys	1	1	
Central locking	/		
Remote locking	•		
Sat. nav. (basic test only)	/		
Reversing camera			

Make:	Jeep	Model:	Wrangler	
Body Style:	Wagon	Year:	2007	
Rego No.:	LHP388	Rego Expiry:	01 Aug 2026	
WoF Expiry:	30 May 2026	Odometer:	133,190 Kms	
Good No.:	27812335	VIN:	1J8GE391X7L174351	
Next Service:	143,194	Service History:	No	

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

ney				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

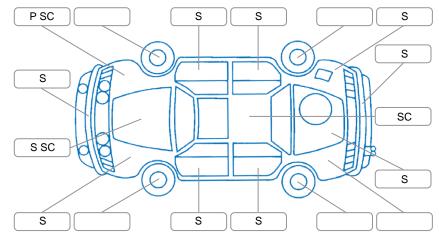

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Stone chips in the windscreen, front bumper has been cut to be shorter,

Conditions During Body Inspection	Dry	
Under Carriage and Under Bonnet Inspection Comments		
Oil looks		

Oil leaks,

Interior Comments	
Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good
General Comments	

4WD, some tints have scratches,

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Jesse Roberts	
Published by:	Jesse Roberts	
Inspection Date:	10 Dec 2025	

I have read and understood
this condition guide:

NAME			