


Make:	Volkswagen	Model:	Golf
Body Style:	Hatchback	Year:	2009
Rego No.:	PET148	Rego Expiry:	30 Apr 2026
WoF Expiry:	28 Nov 2025	Odometer:	92,514 Kms
Good No.:	27813809	VIN:	WVWZZZ1KZAW184160
Next Service:	26/3/26	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

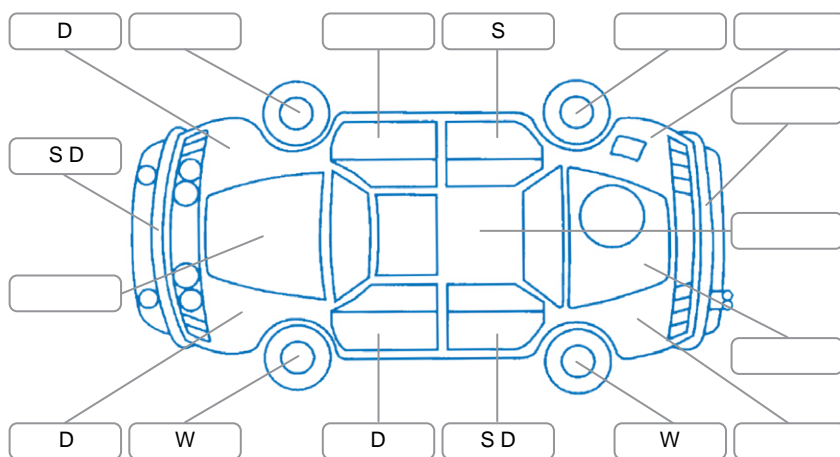

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

L front wheel cap missing

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

F bumper hook cover missing, air con blower not working, r tail light water inside, L tail light cracked, interior door panel sagging, engine oil leak, battery not secured, R front outer cv boot split, both front tyre side wall low,

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Marlon Espena
Published by:	Marlon Espena
Inspection Date:	27 Nov 2025

I have read and understood this condition guide:

NAME _____

SIGNATURE _____

Report ID:	27,813,809	Version:	1
Created:	27 Nov 2025		

	OK	Requires Attention	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5 mm
Right front			5 mm
Left rear			8 mm
Right rear			8 mm
Spare		No	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓