

Basic Condition Guide

•	Report ID:	27,815,203	Version:	1
	Created:	03 Dec 2025		

	OK	Requires Attention	
Engine			
Oil level	~		
Smoke & fumes	/		
Engine performance	1		
Noise	•		
Coolant condition	~		
Cooling performance	1		
Radiator / Hoses (visual)	/		
Transmission			
Operation	/		
Noise	/		
Clutch			1
CV joints	1		
Wheel bearings	/		
Brakes			
Performance	1		
Hand brake	~		
Tyres (lowest observed tread d	epth of	tyres)	
Left front			1.5 mm
Right front			5.0 mm
Left rear		3	3.5 mm
Right rear			1.5 mm
Spare	Yes		
Suspension			
Suspension performance	1		
Steering performance	1		
Shock absorbers	1		
Air Conditioning / Heater			•
Operation	/		
Electrical / Accessories			
Head lights	/		
Tail lights	/		
Indicators	1		
Dashboard warning lights	1		
Wipers (front & rear)	1		
Window winder FL	1		
Window winder FR	1		
Window winder RL	1		
Window winder RR	1		
Rear view mirrors	1		
Radio (basic test only)	1		
			~
CD (basic test only)			
CD (basic test only) Number of keys	1		
	1		
Number of keys	1		
Number of keys Central locking	/		


Make:	Hyundai	Model:	Santa FE
Body Style:	suv	Year:	2017
Rego No.:	KKQ4	Rego Expiry:	27 Feb 2026
WoF Expiry:	16 Jul 2026	Odometer:	165,344 Kms
Good No.:	27815203	VIN:	KMHSU81BSHU750679
Next Service:	173,715	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Kev

Key				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chins	

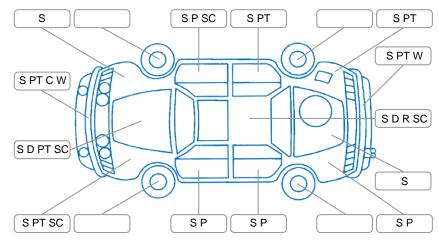

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Minor stone chips in windscreen

Moisture in left mirror indicator - cracked

Conditions During Body Inspection	Dry			
Under Carriage and Under Ronnet Inspection Comments				

Gouge in left rear tyre Rear brake pads low

Oil leak

Interior Comments		
Seats:	Front seats worn	
Carpets:	Average	
Panels:	Average	
Dashboard:	Average	
General Comments		

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Samuel Weir	
Published by:	David Duke	
Inspection Date:	01 Dec 2025	

I	have	read	and	understoo	od
t	his co	nditi	on a	uide.	

NAME			