


# **Basic Condition Guide**

Report ID:	27,815,827	Version:	1
Created:	02 Dec 2025		

Make:	Toyota	Model:	Landcruiser		
Body Style:	Utility	Year:	2014		
Rego No.:	NGB446	Rego Expiry:	17 Dec 2025		
WoF Expiry:	07 Nov 2026	Odometer:	241,332 Kms		
Good No.:	27815827	VIN:	JTELV71J300034282		
Next Service:	245,000kms	Service History:	Yes		
Note: This report is not a warranty  This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.					

### Key

W = Significant scuffs S = ScratchR = RustC = Crack\* = DecalsD = DentPT = Paint defect P = Pin dentSC = Stone Chips

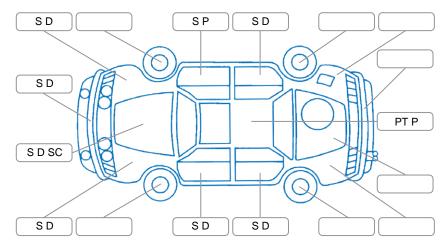

Note: some defects and blemishes may not be displayed in the diagram

## **Body Inspection Comments**

Grille broken. Aerial broken.

Chipped windscreen.

Running boards damaged.

Right headlight cracked, moisture inside.

Conditions During Body Inspection	Dry			
Under Carriage and Under Bonnet Inspection Comments				

Left swivel hub leaking oil.

Rear differential oil seepage.

Gearbox crossmember dented.

Interior Comments	
Seats:	Average
Carpets:	Splits on drivers side.
Panels:	Hand brake boot damaged.
Dashboard:	Steering wheel worn.

#### **General Comments**

Service history to 2017 only.

Heater mode switch not working.

4x4 manual diesel flat deck Landcruiser.

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Daryll Timms	
Published by:	Daryll Timms	
Inspection Date:	02 Dec 2025	

I have read and understood					
this condition quide					

NAME			

	ОК	Requires Attention	N/A
Engine			
Oil level	<b>/</b>		
Smoke & fumes	/		
Engine performance	<b>✓</b>		
Noise	<b>✓</b>		
Coolant condition	V V V		
Cooling performance	<b>✓</b>		
Radiator / Hoses (visual)	<b>✓</b>		
Transmission			
Operation	<b>✓</b>		
Noise	/		
Clutch	<b>/</b>		
CV joints		<b>'</b>	
Wheel bearings	<b>/</b>		
Brakes			
Performance	<b>/</b>		
Hand brake	<b>/</b>		
Tyres (lowest observed tread d	epth of	tyres)	
Left front			10 mm
Right front			10 mm
Left rear			10 mm
Right rear			10 mm
Spare	Yes		
Suspension			
Suspension performance	/		
Steering performance	<i>'</i>		
Shock absorbers	<b>✓</b>		
Air Conditioning / Heater			
Operation		•	
Electrical / Accessories			
Head lights	/		
Tail lights	✓ ✓		
Indicators	V		
Dashboard warning lights	/		
Wipers (front & rear)	V		
Window winder FL	/		
Window winder FR	/		
Window winder RL			~
Window winder RR			~
Rear view mirrors			V
Radio (basic test only)	<b>✓</b>		
CD (basic test only)	<b>✓</b>		
Number of keys	4		
Central locking			V
Remote locking			V
Sat. nav. (basic test only)			~
Reversing camera			V