

Basic Condition Guide

•	Report ID:	27,816,902	Version:	1
	Created:	28 Nov 2025		

	ОК	Requires Attention	 N/A
Engine			
Oil level	1		
Smoke & fumes	1		
Engine performance			
Noise	\(\times \)		
Coolant condition	1		
Cooling performance	1		
Radiator / Hoses (visual)	1		
Transmission		ı	
Operation	V		
Noise	1		
Clutch			/
CV joints	1		
Wheel bearings	1		
Brakes			
Performance	V		
Hand brake	1		
Tyres (lowest observed tread o	lepth of	tvres)	
Left front			6.0 mm
Right front			3.0 mm
Left rear			7.0 mm
Right rear			5.0 mm
Spare	Yes		
Suspension			
Suspension performance	1		
Steering performance	1		
Shock absorbers	1		
Air Conditioning / Heater			
Operation	V		
Electrical / Accessories			
Head lights		· ·	
Tail lights		<i>'</i>	
Indicators	1	_	
Dashboard warning lights	~		
Wipers (front & rear)	~		
Window winder FL	~		
Window winder FR			
Window winder RL	V		
Window winder RR	V		
Rear view mirrors	1		
Radio (basic test only)	1		
	1		
CD (basic test only)	1	l	L
Number of keys Control locking	· ·	1	
Central locking	1		
Remote locking			
Sat. nav. (basic test only)			
Reversing camera		I	. <i>V</i>


Make:	Honda	Model:	FIT
Body Style:	Hatchback	Year:	2003
Rego No.:	EFJ215	Rego Expiry:	30 Dec 2025
WoF Expiry:	15 Nov 2025	Odometer:	157,221 Kms
Good No.:	27816902	VIN:	7A88G2Y0707533588
Next Service:	158,000	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Kev

ney				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

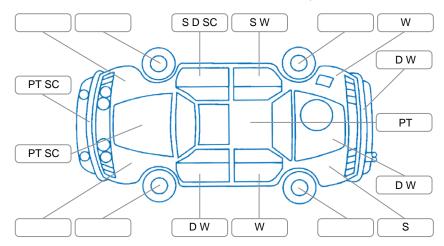

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Headlights faded. Spare tyre bracket broken. Clear coat faded. Left wing mirror scuffed. Right rear of rear bumper poor fitment.

	Under Carriage and Under Bonnet Inspection Comments			
Conditions During Body Inspection Dry				

Power steering heavy at low speeds.

Interior Comments			
Seats:	front passenger has burn mark.		
Carpets:	Average		
Panels:	Average		
Dashboard:	Average		

General Comments

Vibration when stopped in drive. Drivers seat not fixed in place, goes back and forth. Right hand license plate light nw. Spare tyre bracket broken. Right front park light nw.

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Finlay Lemmens	
Published by:	Saxon Ewen	
Inspection Date:	27 Nov 2025	

I have read and understood	k
this condition quide	

NAME			