

Report ID:	27,817,854	Version:	1
Created:	04 Dec 2025		


Make:	Ford	Model:	Fiesta
Body Style:	Hatchback	Year:	2007
Rego No.:	EDW581	Rego Expiry:	31 Dec 2025
WoF Expiry:	17 Oct 2026	Odometer:	163,294 Kms
Good No.:	27817854	VIN:	WF0HXXGAJH7T57296
Next Service:	167,200kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

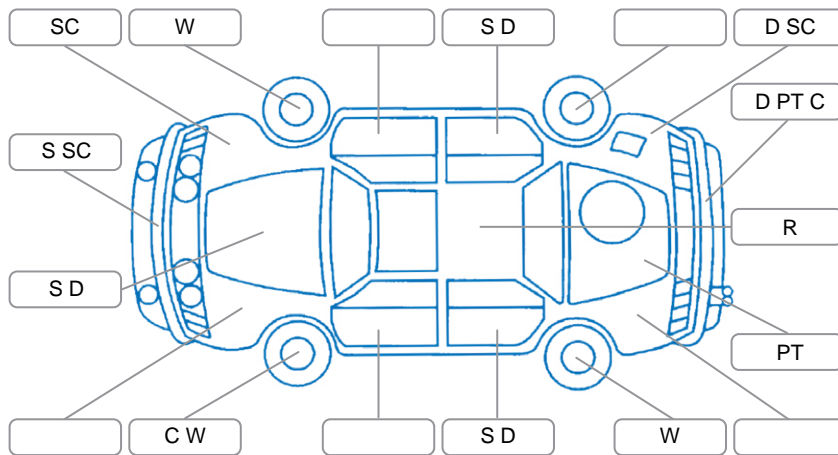

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Left front windshield corner cover is missing. Right door mirror housing is cracked. No parcel tray. Right rear edge of roof is rusty. Water in High mount stop light and not operating. Right brake light is not operating. Aerial is missing.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Oil leaking from around transmission.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Tail gate opener regulator is not operating, needs a key to open.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 115,999 Kms
Inspected by:	Yuki Itohara
Published by:	Glen Charlton
Inspection Date:	04 Dec 2025

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			2.5 mm
Right front			4.0 mm
Left rear			3.5 mm
Right rear			4.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓