

Report ID:	27,829,465	Version:	1
Created:	04 Dec 2025		


Make:	Ford	Model:	Territory
Body Style:	SUV	Year:	2006
Rego No.:	DHE363	Rego Expiry:	29 Jan 2026
WoF Expiry:	13 Feb 2026	Odometer:	271,548 Kms
Good No.:	27829465	VIN:	6FPAAAJGAT6T76683
Next Service:	no record	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

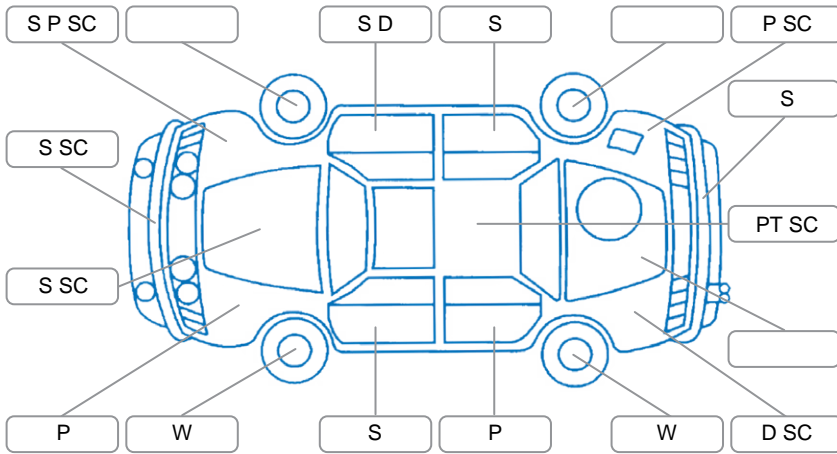

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Left door mirror housing is broken. Edge of right tail light is cracked. Minor wiper scratch in right side of windshield. Paint is fading on roof. Right front guard indicator is cracked. Left front wheel centre cap is cracked. Left rear wheel centre cap is missing.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Oil leaking from engine. Major oil leak from transmission main seal. Both front scuff plates are cracked. Right front door seal is torn. Minor surface rust in engine bay and side sills. Rear wiper arm is broken and washer is faulty.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Right front door trim is broken.
Dashboard:	Centre pocket lid is broken.

General Comments

Light headlight low beam is not operating. Left front door lock is faulty. Traction control switch is faulty. Bonnet opener is broken. Power steering is noisy. Front suspensions have minor knocking when passing bump. Main switch for Right rear window is faulty.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Yuki Itohara		
Published by:	Glen Charlton		
Inspection Date:	03 Dec 2025		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			4.5 mm
Left rear			6.0 mm
Right rear			2.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators		✓	
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking		✓	
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____