

|            |             |          |   |
|------------|-------------|----------|---|
| Report ID: | 27,833,822  | Version: | 1 |
| Created:   | 04 Dec 2025 |          |   |


|               |             |                  |                   |
|---------------|-------------|------------------|-------------------|
| Make:         | Nissan      | Model:           | March             |
| Body Style:   | Hatchback   | Year:            | 2007              |
| Rego No.:     | LZY571      | Rego Expiry:     | 28 Feb 2026       |
| WoF Expiry:   | 01 Mar 2026 | Odometer:        | 108,871 Kms       |
| Good No.:     | 27833822    | VIN:             | 7AT0DH0KX18339878 |
| Next Service: | 111,000 Kms | Service History: | No                |

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

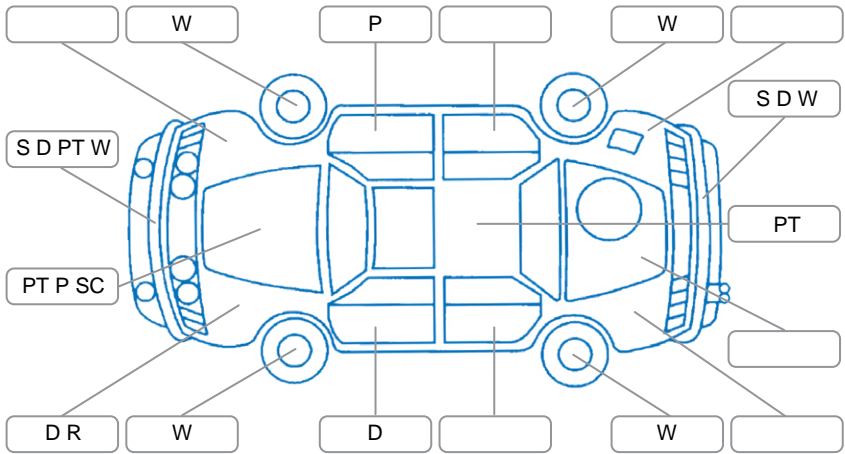

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Front tyres wearing out  
Stone chip in front windscreen  
Rust in boot lid jamb and boot lid gas strut(s) worn  
Small surface rust spot on right inside edge of right rear door

|                                   |     |
|-----------------------------------|-----|
| Conditions During Body Inspection | Wet |
|-----------------------------------|-----|

**Under Carriage and Under Bonnet Inspection Comments**

2WD  
Surface rust on underside of radiator support panel and under spare wheel well

**Interior Comments**

|            |                       |
|------------|-----------------------|
| Seats:     | Stains on front seats |
| Carpets:   | Good                  |
| Panels:    | Good                  |
| Dashboard: | Good                  |

**General Comments**

|                                   |                              |                             |     |
|-----------------------------------|------------------------------|-----------------------------|-----|
| Road Conditions During Test Drive | Wet                          |                             |     |
| Engine Timing Mechanism           | Timing Chain                 |                             |     |
| Evidence of Cam Belt Replacement  | <input type="checkbox"/> Yes | <input type="checkbox"/> No | Kms |
| Inspected by:                     | Hoani Saunders               |                             |     |
| Published by:                     | Jaela Auker                  |                             |     |
| Inspection Date:                  | 04 Dec 2025                  |                             |     |

|   | OK | Requires Attention | N/A    |
|---|----|--------------------|--------|
| <b>Engine</b>                                       |    |                    |        |
| Oil level   | ✓  |                    |        |
| Smoke & fumes                                       | ✓  |                    |        |
| Engine performance                                  | ✓  |                    |        |
| Noise   | ✓  |                    |        |
| Coolant condition                                   | ✓  |                    |        |
| Cooling performance                                 | ✓  |                    |        |
| Radiator / Hoses (visual)                           | ✓  |                    |        |
| <b>Transmission</b>                                 |    |                    |        |
| Operation   | ✓  |                    |        |
| Noise   | ✓  |                    |        |
| Clutch  |    |                    | ✓      |
| CV joints   | ✓  |                    |        |
| Wheel bearings                                      | ✓  |                    |        |
| <b>Brakes</b>                                       |    |                    |        |
| Performance   | ✓  |                    |        |
| Hand brake  | ✓  |                    |        |
| <b>Tyres (lowest observed tread depth of tyres)</b> |    |                    |        |
| Left front  |    |                    | 1.6 mm |
| Right front   |    |                    | 1.9 mm |
| Left rear   |    |                    | 2.9 mm |
| Right rear  |    |                    | 3.2 mm |
| Spare   |    | Yes                |        |
| <b>Suspension</b>                                   |    |                    |        |
| Suspension performance                              | ✓  |                    |        |
| Steering performance                                | ✓  |                    |        |
| Shock absorbers                                     | ✓  |                    |        |
| <b>Air Conditioning / Heater</b>                    |    |                    |        |
| Operation   | ✓  |                    |        |
| <b>Electrical / Accessories</b>                     |    |                    |        |
| Head lights   | ✓  |                    |        |
| Tail lights   | ✓  |                    |        |
| Indicators  | ✓  |                    |        |
| Dashboard warning lights                            | ✓  |                    |        |
| Wipers (front & rear)                               | ✓  |                    |        |
| Window winder FL                                    | ✓  |                    |        |
| Window winder FR                                    | ✓  |                    |        |
| Window winder RL                                    | ✓  |                    |        |
| Window winder RR                                    | ✓  |                    |        |
| Rear view mirrors                                   | ✓  |                    |        |
| Radio (basic test only)                             | ✓  |                    |        |
| CD (basic test only)                                | ✓  |                    |        |
| Number of keys                                      | 1  |                    |        |
| Central locking                                     | ✓  |                    |        |
| Remote locking                                      | ✓  |                    |        |
| Sat. nav. (basic test only)                         |    |                    | ✓      |
| Reversing camera                                    |    |                    | ✓      |

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_