

Basic Condition Guide

•	Report ID:	27,842,372	Version:	1
	Created:	12 Dec 2025		

	ОК	Requires Attention	N/A
Engine	OK	Attention	IN/A
Oil level	/		1
Smoke & fumes	~		
Engine performance	1		
Noise	V		
Coolant condition	V		
Cooling performance	V		
Radiator / Hoses (visual)	<i>'</i>		
Transmission			
Operation		<i>\</i>	
Noise	J	_	
Clutch			<u> </u>
CV joints	J		<u> </u>
	<i>J</i>		
Wheel bearings Brakes			
Performance	J		
Hand brake	.1		
		<u> </u>	
Tyres (lowest observed tread d	epth of		`
Left front			6.5 mm
Right front			7.0 mm
Left rear			4.5 mm
Right rear		(5.0 mm
Spare	Yes		
Suspension		ı	
Suspension performance	/		
Steering performance	/		
Shock absorbers	/		
Air Conditioning / Heater			
Operation			
Electrical / Accessories		ı	1
Head lights	✓		
Tail lights	/		
Indicators	✓		
Dashboard warning lights	/		
Wipers (front & rear)	✓		
Window winder FL	/		
Window winder FR	/		
Window winder RL	/		
Window winder RR	1		
Rear view mirrors	/		
Radio (basic test only)	/		
CD (basic test only)	1		
Number of keys	2		
Central locking	/		
Remote locking	/		
Sat. nav. (basic test only)	/		
Reversing camera	/		


Make:	Nissan	Model:	X-Trail
Body Style:	Wagon	Year:	2010
Rego No.:	MDS865	Rego Expiry:	13 Apr 2026
WoF Expiry:	27 Dec 2025	Odometer:	220,400 Kms
Good No.:	27842372	VIN:	7AT0DH6LX19100182
Next Service:	228,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Kev

ney				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

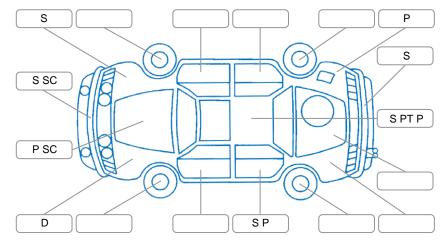

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Minor hail damage and paint fading on roof. Right rear monsoon visor is missing.

Conditions During Body Inspection		Dry
Under Carriage and Under Bonnet	Inspection Comm	ents

Leaking from engine and transmission. Drive shaft for 4WD had been removed, diff condition is unknown.

Interior Comments			
Seats:	Right front base pad trim is worn.		
Carpets: Good			
Panels: Good			
Dashboard: Good			
General Comn	General Comments		

AC blower is not operating.

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Yuki Itohara	
Published by:	Glen Charlton	
Inspection Date:	11 Dec 2025	

I have read and understood
this condition guide:

NAME			