

Basic Condition Guide

•	Report ID:	27,846,225	Version:	1
	Created:	15 Dec 2025		

OK

Requires


N/A

Make:	Mercedes-Benz	Model:	E280
Body Style:	Sedan	Year:	2000
Rego No.:	FWZ583	Rego Expiry:	16 Dec 2025
WoF Expiry:	04 Nov 2026	Odometer:	198,423 Kms
Good No.: 27846225		VIN:	WDB2100632B106607
Next Service:	206,000kms	Service History:	No

diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

* = DecalsW = Significant scuffs S = ScratchR = RustC = CrackD = DentPT = Paint defect P = Pin dentSC = Stone Chips

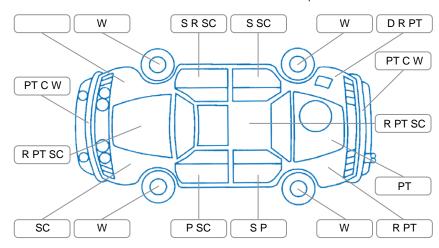

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Reflector and rear fog light on toot are cracked. Right front door scuff plate is not fitted.

Conditions During Body Inspection	Dry		
Under Carriage and Under Bonnet Inspection Comments			

Weeping from engine. Leaking from transmission. Leaking from diff.

Interior Comments		
Seats:	Average	
Carpets:	Average	
Panels:	Average	
Dashboard:	Cracks on top.	

General Comments

Left front speaker is faulty. Left front seat switch panel is not fitted correctly. AC is not cold. CD stacker is jammed. High beam is faulty (does not stay high ON). Right rear window is not operating. Right front seat back adjuster is faulty.

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Yuki Itohara	
Published by:	Henry Belt	
Inspection Date:	15 Dec 2025	

I have read and understood			
this condition guide:	NAME		

	OK	Attention	N/A
Engine			
Oil level	/		
Smoke & fumes	/		
Engine performance	V		
Noise	/		
Coolant condition	/		
Cooling performance	~		
Radiator / Hoses (visual)	~		
Transmission			•
Operation	~		
Noise	/		
Clutch			1
CV joints	/		
Wheel bearings	/		
Brakes			
Performance	~		
Hand brake	/		
Tyres (lowest observed tread d	epth of	tyres)	
Left front	•		6.5 mm
Right front			6.0 mm
Left rear			3.5 mm
Right rear			4.0 mm
Spare	Yes		
Suspension			
Suspension performance	/		
Steering performance	/		
Shock absorbers			
Air Conditioning / Heater		l .	
Operation		·	
Electrical / Accessories			
Head lights	/		
Tail lights			
Indicators			
Dashboard warning lights	· /		_
Wipers (front & rear)	~		
Window winder FL	· /		
Window winder FR	V		
Window winder RL	~		
Window winder RR		~	
Rear view mirrors			
Radio (basic test only)			
CD (basic test only)	•		· /
Number of keys	1	<u> </u>	
Central locking			Ι
Remote locking	· /		-
Sat. nav. (basic test only)			/
Reversing camera			<i>\'\'</i>
neversing carriera		<u> </u>	_

SIGNATURE		