


| | | | |
|---------------|-------------|------------------|-------------------|
| Make: | Holden | Model: | Barina |
| Body Style: | Hatchback | Year: | 2010 |
| Rego No.: | NCJ172 | Rego Expiry: | 28 Jul 2026 |
| WoF Expiry: | 05 Jun 2026 | Odometer: | 111,654 Kms |
| Good No.: | 27858434 | VIN: | KL3SF08619B661653 |
| Next Service: | 110,600kms | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

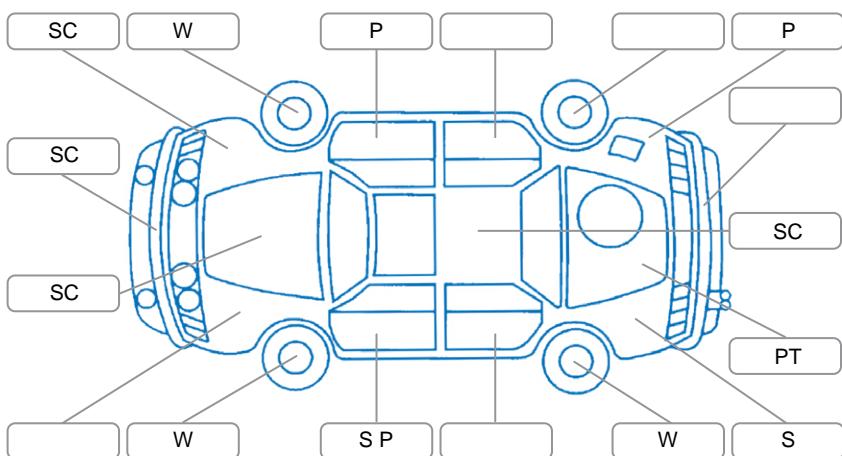

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Minor stone crack in left side of windshield. Paint of door handles are flaking. Left rear tyre needs replacement. Left rear wheel centre cap is missing.

| | |
|-----------------------------------|-----|
| Conditions During Body Inspection | Dry |
|-----------------------------------|-----|

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

| | |
|------------|------|
| Seats: | Good |
| Carpets: | Good |
| Panels: | Good |
| Dashboard: | Good |

General Comments

Ashtray is missing.

| | | |
|-----------------------------------|---|------------|
| Road Conditions During Test Drive | Dry | |
| Engine Timing Mechanism | Cambelt | |
| Evidence of Cam Belt Replacement | <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | 63,316 Kms |
| Inspected by: | Yuki Itohara | |
| Published by: | Tiaan Pienaar | |
| Inspection Date: | 15 Dec 2025 | |

I have read and understood
this condition guide:

NAME _____

| | OK | Requires Attention | N/A |
|---|----|--------------------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Engine performance | ✓ | | |
| Noise | ✓ | | |
| Coolant condition | ✓ | | |
| Cooling performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | | 4.5 mm | |
| Right front | | 4.5 mm | |
| Left rear | | 1.0 mm | |
| Right rear | | 2.5 mm | |
| Spare | | Yes | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | | | ✓ |
| Window winder RR | | | ✓ |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | | | ✓ |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | | | ✓ |
| Sat. nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

SIGNATURE _____