

Report ID:	27,860,393	Version:	1
Created:	15 Dec 2025		


Make:	Lexus	Model:	IS250
Body Style:	Sedan	Year:	2005
Rego No.:	KPR419	Rego Expiry:	19 May 2026
WoF Expiry:	23 May 2026	Odometer:	216,792 Kms
Good No.:	27860393	VIN:	7AT0B00EX17006495
Next Service:	222500 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key

S = Scratch R = Rust C = Crack \* = Decals W = Significant scuffs  
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

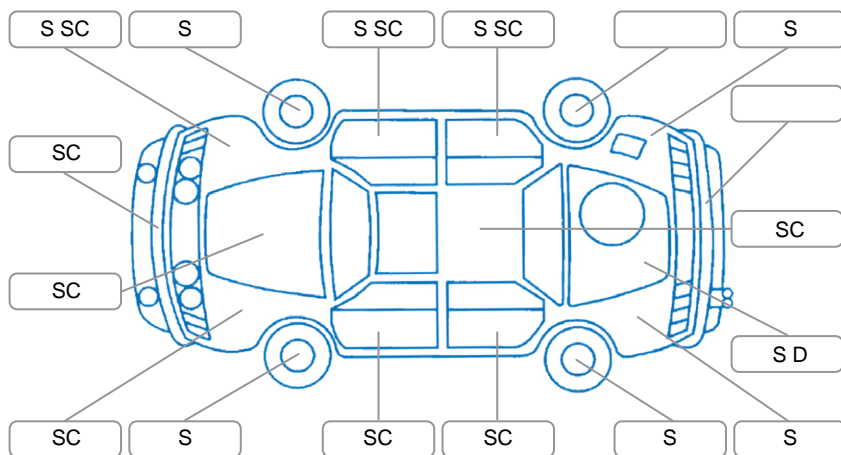

Note: some defects and blemishes may not be displayed in the diagram

## Body Inspection Comments

Both sills scratched.

Conditions During Body Inspection Dry

## Under Carriage and Under Bonnet Inspection Comments

R/R shock leaking. R/R outer CV boot leaking. Oil leak from rear of engine or gearbox.

## Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Poor
Dashboard:	Poor

## General Comments

Transmission fault when slowing down to stop, thumps into first gear. Dash and door trims badly cracked and worn. Stereo screen flickers. Outer window rubbers worn. Minor windscreen chips. Boot won't open. Drivers door interior handle faulty.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Chris McQuade		
Published by:	Nitiphum Yordsiri		
Inspection Date:	15 Dec 2025		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation		✓	
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			6.2 mm
Right front			6.8 mm
Left rear			3.7 mm
Right rear			2.7 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers		✓	
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_