


| | | | |
|---------------|-------------|------------------|-------------------|
| Make: | Mazda | Model: | MPV |
| Body Style: | Wagon | Year: | 2006 |
| Rego No.: | NLP231 | Rego Expiry: | 10 May 2026 |
| WoF Expiry: | 04 Dec 2026 | Odometer: | 159,287 Kms |
| Good No.: | 27862222 | VIN: | 7AT0C11EX21107448 |
| Next Service: | 166,542 | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

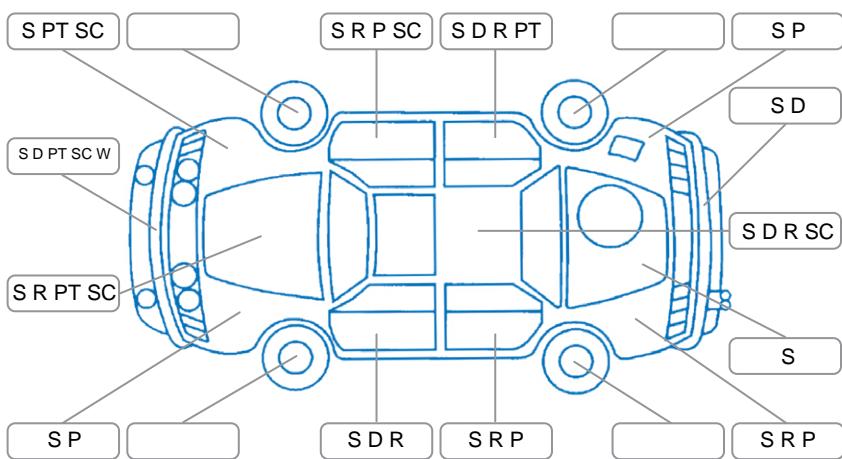

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

| | |
|-----------------------------------|-----|
| Conditions During Body Inspection | Dry |
|-----------------------------------|-----|

Under Carriage and Under Bonnet Inspection Comments

LR, RF, LF tyres shoulder worn. Left CV joints leaking grease. Oil leak, seepage from turbo. Underbody surface rust

Interior Comments

| | |
|------------|----------------------------|
| Seats: | Stains |
| Carpets: | Average |
| Panels: | Drivers trim piece missing |
| Dashboard: | Average |

General Comments

Steering pulls to left. Clunking noise from front suspension. Volume knob missing. Centre left seatbelt fraying. Interior odor

| | |
|-----------------------------------|--|
| Road Conditions During Test Drive | Dry |
| Engine Timing Mechanism | Timing Chain |
| Evidence of Cam Belt Replacement | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Inspected by: | Samuel Weir |
| Published by: | Desian Robb |
| Inspection Date: | 18 Dec 2025 |

I have read and understood
this condition guide:

NAME _____

| | | | |
|------------|-------------|----------|---|
| Report ID: | 27,862,222 | Version: | 1 |
| Created: | 23 Dec 2025 | | |

| | OK | Requires Attention | N/A |
|---|--------|--------------------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Engine performance | ✓ | | |
| Noise | ✓ | | |
| Coolant condition | ✓ | | |
| Cooling performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 1.5 mm | | |
| Right front | 2.0 mm | | |
| Left rear | 2.5 mm | | |
| Right rear | 3.0 mm | | |
| Spare | N/A | | |
| Suspension | | | |
| Suspension performance | | ✓ | |
| Steering performance | | ✓ | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | | | ✓ |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

SIGNATURE _____