


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2010
Rego No.:	HKK465	Rego Expiry:	21 Dec 2025
WoF Expiry:	25 Sep 2026	Odometer:	313,234 Kms
Good No.:	27870374	VIN:	MMAJRKA40BD003627
Next Service:	due	Service History:	No

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

#### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

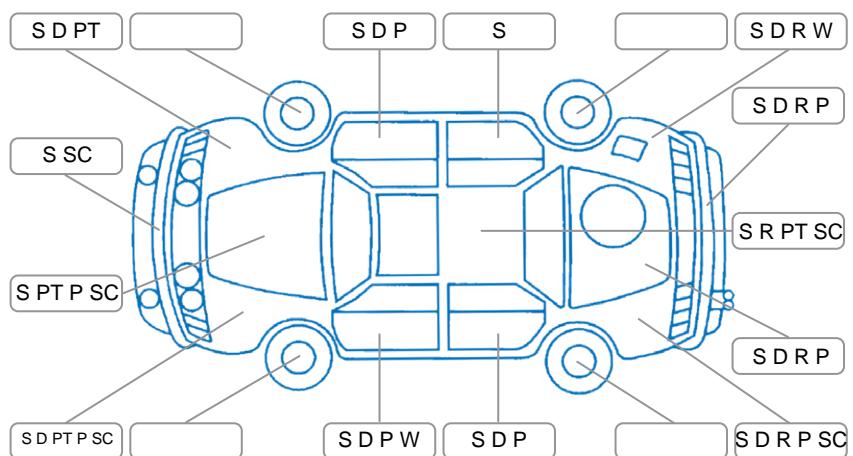

Note: some defects and blemishes may not be displayed in the diagram

#### Body Inspection Comments

Airbag light on. Drivers seatbelt twisted, retractor requires attention. L brake and headlight out. Oil seepage. Coolant overflow lid missing. Headlights yellowed.

Conditions During Body Inspection	Dry
-----------------------------------	-----

#### Under Carriage and Under Bonnet Inspection Comments

Under tray impact damaged. L steering rack requires attention. Underbody rust. Rear differential leaking.

#### Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

#### General Comments

Turbo whine

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Inspected by:	Darren Beban
Published by:	David Duke
Inspection Date:	02 Jan 2026

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

Report ID:	27,870,374	Version:	1
Created:	05 Jan 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	4.5	mm	
Right front	4.5	mm	
Left rear	4.5	mm	
Right rear	4.5	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights		✓	
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE \_\_\_\_\_