

Report ID:	27,872,125	Version:	1
Created:	19 Dec 2025		


Make:	Ford	Model:	Mondeo
Body Style:	Hatchback	Year:	2011
Rego No.:	GEN509	Rego Expiry:	20 Jan 2026
WoF Expiry:	22 Apr 2026	Odometer:	242,096 Kms
Good No.:	27872125	VIN:	WF0EXXGGBEBU04680
Next Service:	231,120 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

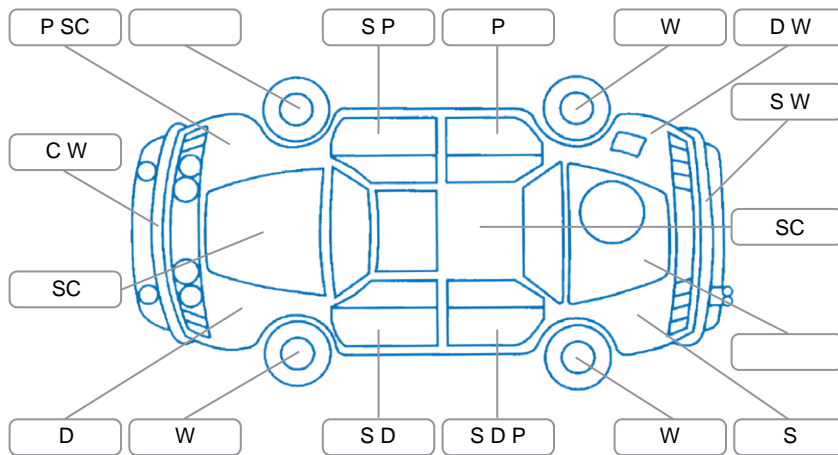

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Crack in front bumper
All tyres worn on inner edges
Rear bumper detaching on right side

Conditions During Body Inspection Wet

Under Carriage and Under Bonnet Inspection Comments

2WD
Oil weep and seepage
Front left outer C.V boot split

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Good

General Comments

Jolting and slight over revving from transmission during test drive. Advise to have transmission inspected

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Hoani Saunders
Published by:	Robert Chardon
Inspection Date:	19 Dec 2025

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation		✓	
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			2.4 mm
Right front			2.3 mm
Left rear			1.8 mm
Right rear			1.7 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓