


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2018
Rego No.:	LLR73	Rego Expiry:	20 Jun 2026
WoF Expiry:	11 Jun 2026	Odometer:	264,418 Kms
Good No.:	27883176	VIN:	MMAJJKL10JH016273
Next Service:	256600	Service History:	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

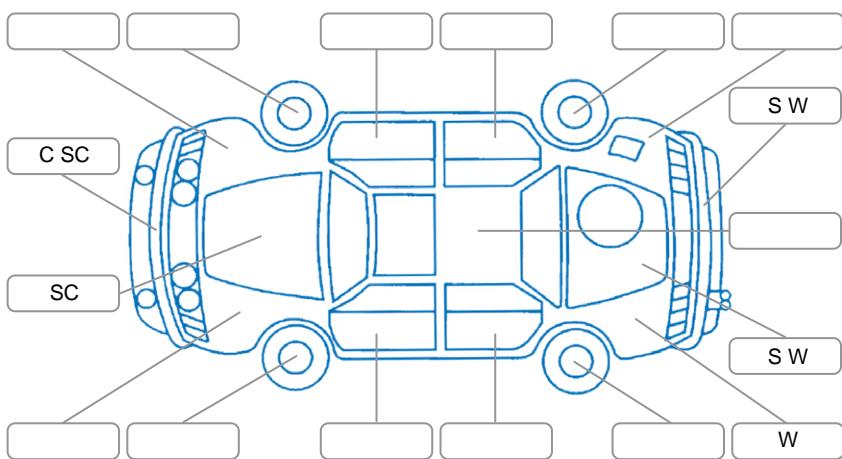

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Rear bumper step plate missing

Conditions During Body Inspection	Wet
-----------------------------------	-----

**Under Carriage and Under Bonnet Inspection Comments**

Partial service records

Front rotors/ pads worn, replace

**Interior Comments**

Seats: stains, drivers seat worn, hole in rear seat back

Carpets: Good

Panels: stains

Dashboard: steering wheel worn

**General Comments**

Engine rattle when cold

Clutch wearing

Hand brake weak

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No
Inspected by:	Greg Morgan
Published by:	Vincent Lam
Inspection Date:	30 Dec 2025

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

Report ID:	27,883,176	Version:	1
Created:	10 Jan 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch		✓	
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance		✓	
Hand brake		✓	
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	10.0	mm	
Right front	10.0	mm	
Left rear	10.0	mm	
Right rear	10.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

SIGNATURE \_\_\_\_\_