


Make:	Mazda	Model:	Demio
Body Style:	Hatchback	Year:	2009
Rego No.:	LQF538	Rego Expiry:	03 Mar 2026
WoF Expiry:	05 Feb 2026	Odometer:	199,824 Kms
Good No.:	27884396	VIN:	7AT0C12HX18199130
Next Service:	200000	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

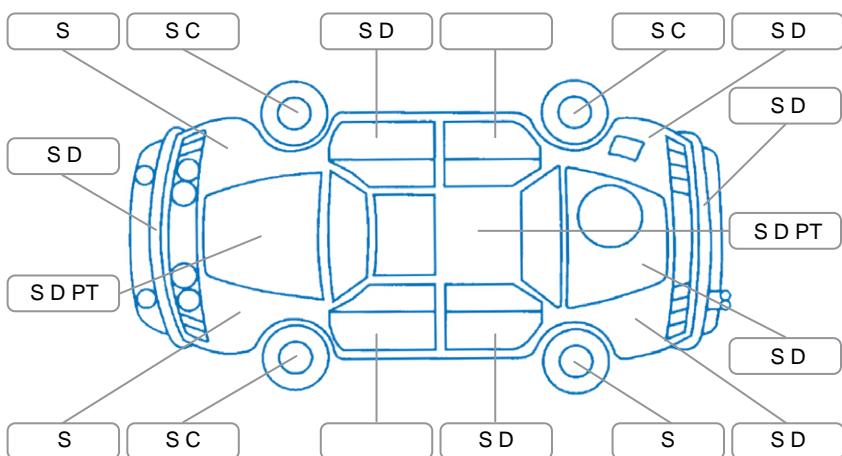

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Front bumper needs alignment ,RR taillight broken,RF door lock barrel missing ,RF door mirror casing gouged,Rear bumper needs alignment ,RF headlight not working ,

Conditions During Body Inspection	Dry
-----------------------------------	-----

**Under Carriage and Under Bonnet Inspection Comments**

Minor oil leak,

**Interior Comments**

Seats:	minor stains ,
Carpets:	minor stains ,
Panels:	Average
Dashboard:	Average

**General Comments**

Drives okay slight missfire  
Drivers door handle missing.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No
Inspected by:	Donovan Matara
Published by:	Logan Lane
Inspection Date:	24 Dec 2025

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

Report ID:	27,884,396	Version:	2
Created:	07 Jan 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance		✓	
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	4.5 mm		
Right front	3.0 mm		
Left rear	5.0 mm		
Right rear	6.8 mm		
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL		✓	
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE \_\_\_\_\_