


Make:	Foton	Model:	Tunland
Body Style:	Utility	Year:	2013
Rego No.:	GSU277	Rego Expiry:	01 Nov 2026
WoF Expiry:	23 Jul 2026	Odometer:	130,542 Kms
Good No.:	27889763	VIN:	LVAV2MBB1DJ002143
Next Service:	due no sticker	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

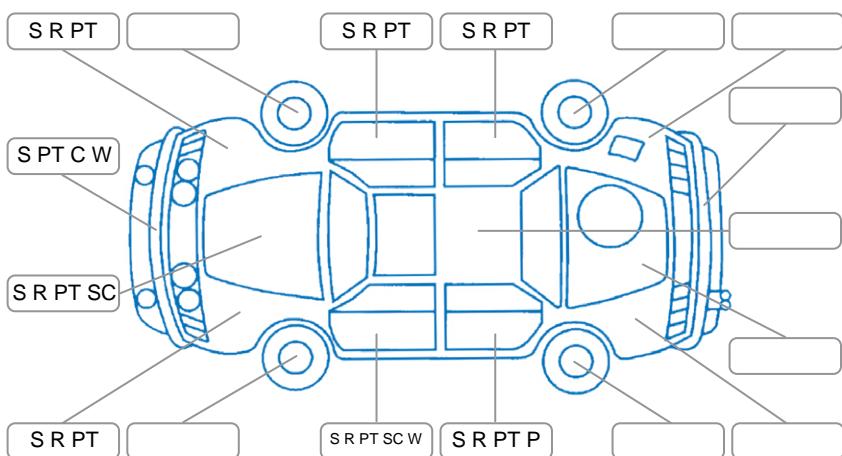

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Headlights yellow. Minor stone chips in windscreen. Antenna damaged
 Large rust bubbles on all doors, RF guard. Rust on back of cab. Keyhole damaged on drivers door.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Oil leak
 Rust hole in sill

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Only 1x key works in ignition. Crunches when going into 3rd gear.

Electric mirrors not working correctly. Drivers wing mirror glass bad funhouse replacement. Aircon fan makes noise but doesn't blow.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No
Inspected by:	Samuel Weir
Published by:	James Scott
Inspection Date:	08 Jan 2026

I have read and understood
 this condition guide:

NAME _____

Report ID:	27,889,763	Version:	1
Created:	09 Jan 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation		✓	
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	3.0	mm	
Right front	3.0	mm	
Left rear	2.0	mm	
Right rear	5.0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL			✓
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors			✓
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking		✓	
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE _____