

Report ID:	27,890,487	Version:	1
Created:	04 Jan 2026		


Make:	Suzuki	Model:	Escudo
Body Style:	SUV	Year:	2002
Rego No.:	EZW532	Rego Expiry:	01 Jul 2026
WoF Expiry:	09 Jan 2026	Odometer:	257,477 Kms
Good No.:	27890487	VIN:	7A8GK4M0709103390
Next Service:	258,000 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key

S = Scratch R = Rust C = Crack \* = Decals W = Significant scuffs  
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

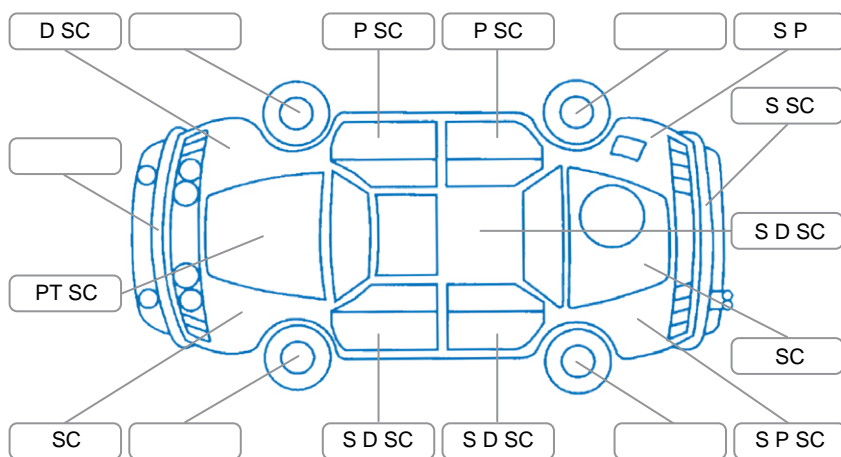

Note: some defects and blemishes may not be displayed in the diagram

## Body Inspection Comments

Paint defect on RH cant rail and side mirror mounts. LH cant rail dented.  
FL door waste moulding damaged, RL door window frame damaged.  
FR door window monsoon missing.  
Missing tyre iron. Lock nut key in glovebox.

Conditions During Body Inspection Dry

## Under Carriage and Under Bonnet Inspection Comments

Engine oil leaks. Front bull bar is mounted poorly.  
Transmission fluid leak.  
LF outer CV boot split.  
Minor undercarriage surface rust.

## Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Average, steering wheel worn.

## General Comments

Front tyres are rubbing when steering at full lock. CV clicking in 4WD.  
Front washers need adjusted.  
AC not cold.  
Both park lights and taillights not working.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Troy Smith		
Published by:	Troy Smith		
Inspection Date:	04 Jan 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints		✓	
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			11 mm
Right front			11 mm
Left rear			11 mm
Right rear			11 mm
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights		✓	
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_