

Report ID:	27,907,215	Version:	1
Created:	13 Jan 2026		


Make:	Mazda	Model:	Premacy
Body Style:	Wagon	Year:	2008
Rego No.:	MJJ635	Rego Expiry:	09 Mar 2026
WoF Expiry:	02 Sep 2026	Odometer:	142,112 Kms
Good No.:	27907215	VIN:	7AT0C133X19311227
Next Service:	150,000 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key

S = Scratch R = Rust C = Crack \* = Decals W = Significant scuffs  
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

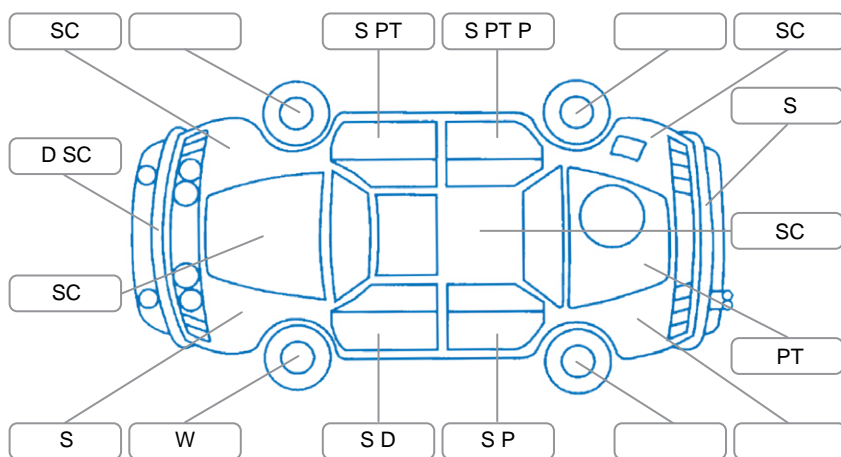

Note: some defects and blemishes may not be displayed in the diagram

## Body Inspection Comments

Roof aerial damaged  
Stone chips in front windscreen  
Sidewall damage on front left tyre  
Rear tyres wearing on inner edges, front tyres starting to wear on inner edges

Conditions During Body Inspection Dry

## Under Carriage and Under Bonnet Inspection Comments

2WD

## Interior Comments

Seats:	Wear on drivers seat
Carpets:	Wear on drivers left side foot rest
Panels:	Good
Dashboard:	Good

## General Comments

Two key remotes, one isn't working

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Hoani Saunders
Published by:	Malcolm Thomas
Inspection Date:	13 Jan 2026

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			2.8 mm
Right front			3.1 mm
Left rear			3.3 mm
Right rear			4.2 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		