


Make:	LDV	Model:	G10
Body Style:	Van	Year:	2017
Rego No.:	LCM346	Rego Expiry:	20 May 2026
WoF Expiry:	19 Nov 2026	Odometer:	144,870 Kms
Good No.:	27917811	VIN:	LSKG4BL14HA057255
Next Service:	153000 kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

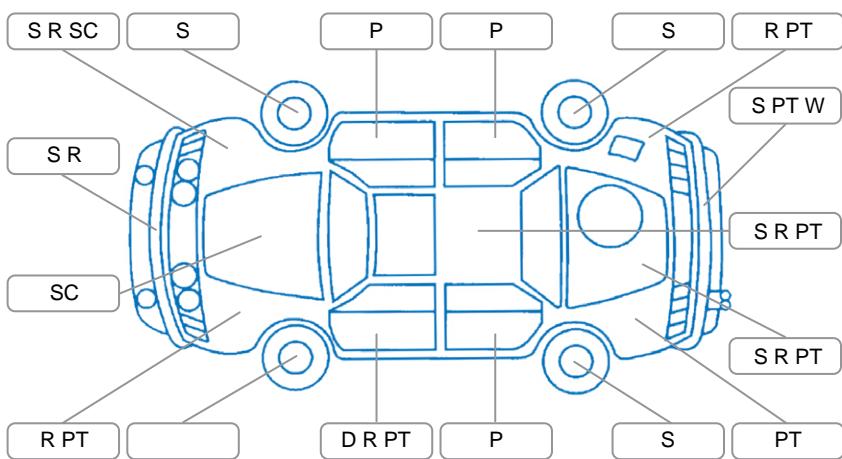

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Bull bar rust.
 Left/right sills damaged and rust

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Under bonnet rust.
 Engine and transmission oil stains.
 Underbody surface rust.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Poor
Dashboard:	Average

General Comments

Engine/transmission/driveline whine.
 Noise from release bearing when clutch is pressed.

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Inspected by:	Eleoit Kumar
Published by:	Sam Huang
Inspection Date:	15 Jan 2026

I have read and understood
 this condition guide:

NAME _____

Report ID:	27,917,811	Version:	3
Created:	30 Jan 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise		✓	
Clutch		✓	
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	8.0	mm	
Right front	9.0	mm	
Left rear	8.0	mm	
Right rear	8.0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

SIGNATURE _____