


Report ID:	27,918,047	Version:	1
Created:	20 Jan 2026		

Make:	LDV	Model:	T60
Body Style:	Utility	Year:	2019
Rego No.:	PQT479	Rego Expiry:	05 Nov 2025
WoF Expiry:	13 Nov 2026	Odometer:	125,270 Kms
Good No.:	27918047	VIN:	LSFAM11A3JA095969
Next Service:	134235 kms	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

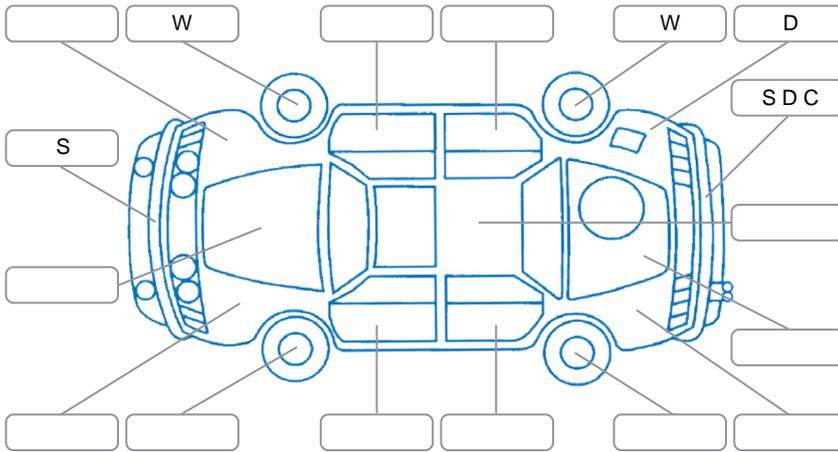

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Rear bumper damage, L rear interior door panel missing, L wing mirror cover and indicator broken, r front fog light damage, underbody rust, engine oil leak, underbody steel cover unsecured,

Conditions During Body Inspection:  Dry  Wet

### Under Carriage and Under Bonnet Inspection Comments

### Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Good

### General Comments

Driver seat torn, engine light on, squeak drive belt, middle glove box broken, carpet torn,

Road Conditions During Test Drive	Wet		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Marlon Espena		
Published by:	Marlon Espena		
Inspection Date:	20 Jan 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5 mm
Right front			5 mm
Left rear			5 mm
Right rear			5 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_