

| | | | |
|------------|-------------|----------|---|
| Report ID: | 27,920,583 | Version: | 1 |
| Created: | 10 Mar 2026 | | |


| | | | |
|---------------|-------------|------------------|-------------------|
| Make: | Ford | Model: | Courier |
| Body Style: | Utility | Year: | 2004 |
| Rego No.: | CGB992 | Rego Expiry: | 15 Apr 2026 |
| WoF Expiry: | 27 Jun 2026 | Odometer: | 346,182 Kms |
| Good No.: | 27920583 | VIN: | MNALSFE404W406068 |
| Next Service: | 349,926km's | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

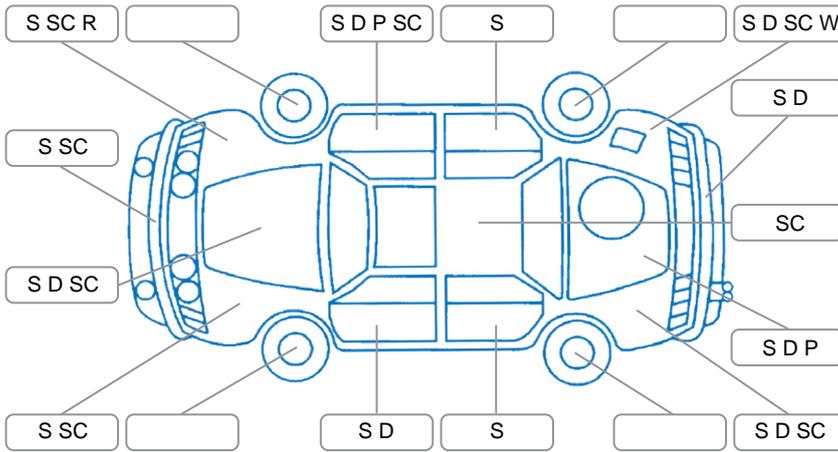

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

No keys for locks on rear canopy door. Some of the tools for using vehicle jack are missing. Paint peeling off canopy roof. Small stone crack in right side of windscreen.

| | |
|-----------------------------------|-----|
| Conditions During Body Inspection | Dry |
|-----------------------------------|-----|

Under Carriage and Under Bonnet Inspection Comments

Oil leak from engine. Right & left side outer cv boots are split. Surface rust on top & bottom radiator support panel. Underbody surface rust.

Interior Comments

| | |
|------------|---------|
| Seats: | Good |
| Carpets: | Average |
| Panels: | Good |
| Dashboard: | Good |

General Comments

Turbo is starting to get a bit noisy. Electric window master switch on driver's door will only operate both right side door windows. Central locking not working on both left side doors. No sound coming from the radio. A/C is not getting cold, needs attention.

| | |
|-----------------------------------|--|
| Road Conditions During Test Drive | Dry |
| Engine Timing Mechanism | Cambelt |
| Evidence of Cam Belt Replacement | <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 334,119 Kms |
| Inspected by: | Jason Young |
| Published by: | Maia Lammers |
| Inspection Date: | 05 Mar 2026 |

| | OK | Requires Attention | N/A |
|---|----|--------------------|--------|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Engine performance | ✓ | | |
| Noise | ✓ | | |
| Coolant condition | ✓ | | |
| Cooling performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | ✓ | | |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | | | 7.4 mm |
| Right front | | | 8.0 mm |
| Left rear | | | 9.5 mm |
| Right rear | | | 9.5 mm |
| Spare | | Yes | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | | ✓ | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | | ✓ | |
| CD (basic test only) | | | ✓ |
| Number of keys | 2 | | |
| Central locking | | ✓ | |
| Remote locking | | | ✓ |
| Sat. nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

I have read and understood this condition guide:

NAME _____

SIGNATURE _____