


Make:	Mazda	Model:	Verisa
Body Style:	Hatchback	Year:	2005
Rego No.:	HKH137	Rego Expiry:	21 Apr 2026
WoF Expiry:	29 Aug 2026	Odometer:	237,045 Kms
Good No.:	27922470	VIN:	7AT0C103X14202029
Next Service:	237,750 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

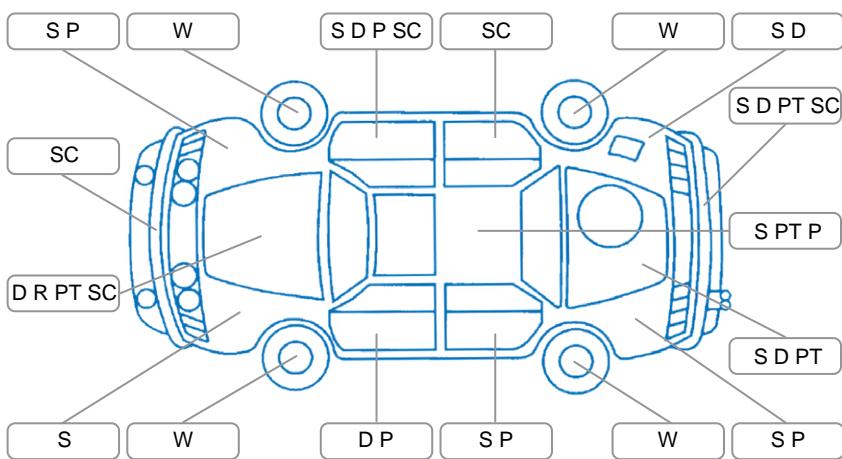

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Roof aerial damaged
Left rear brake light isn't working

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

2WD
Oil weep and seepage

Interior Comments

Seats:	Average. Stains, front seat covers fitted		
Carpets:	Wear on drivers side		
Panels:	Centre console storage lid worn		
Dashboard:	Good		

General Comments

Check engine warning light on
Vehicle cut out during test drive, was losing power

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No
Inspected by:	Hoani Saunders
Published by:	Robert Chardon
Inspection Date:	19 Jan 2026

I have read and understood
this condition guide:

NAME _____

Report ID:	27,922,470	Version:	1
Created:	20 Jan 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance		✓	
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	5.3 mm		
Right front	5.4 mm		
Left rear	5.8 mm		
Right rear	3.9 mm		
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE _____