

Report ID:	27,935,196	Version:	1
Created:	03 Feb 2026		


Make:	Ssangyong	Model:	Rhino
Body Style:	Utility	Year:	2019
Rego No.:	RLT597	Rego Expiry:	21 Apr 2026
WoF Expiry:	09 Dec 2026	Odometer:	107,583 Kms
Good No.:	27935196	VIN:	KPAYA1EESJP041932
Next Service:	102,000	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key

S = Scratch R = Rust C = Crack \* = Decals W = Significant scuffs  
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

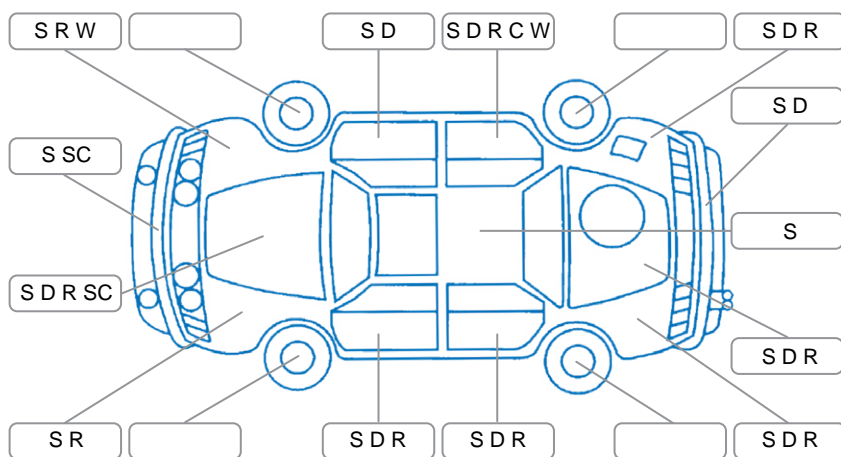

Note: some defects and blemishes may not be displayed in the diagram

## Body Inspection Comments

Tailgate Not Opening  
Large Stone Chips Windscreen  
Spare Wheel in Tray, Not Secured  
Right Rear Door Handle Cracked & Right Mirror Indicator Cracked.

Conditions During Body Inspection Dry

## Under Carriage and Under Bonnet Inspection Comments

Oil Leak  
Aftermarket Suspension

## Interior Comments

Seats: Average  
Carpets: Average  
Panels: Poor  
Dashboard: Average

## General Comments

Needs Wiper Blades  
Right Mirror Not Adjusting  
Transmission Mode Button Jammed

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Samuel Weir		
Published by:	David Duke		
Inspection Date:	30 Jan 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			7.0 mm
Right front			6.5 mm
Left rear			6.5 mm
Right rear			2.5 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL		✓	
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_