

Report ID:	27,936,892	Version:	2
Created:	03 Mar 2026		


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2017
Rego No.:	LBT442	Rego Expiry:	27 Jun 2026
WoF Expiry:	27 Feb 2027	Odometer:	171,155 Kms
Good No.:	27936892	VIN:	MMAWYKL10HH018671
Next Service:	170000	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

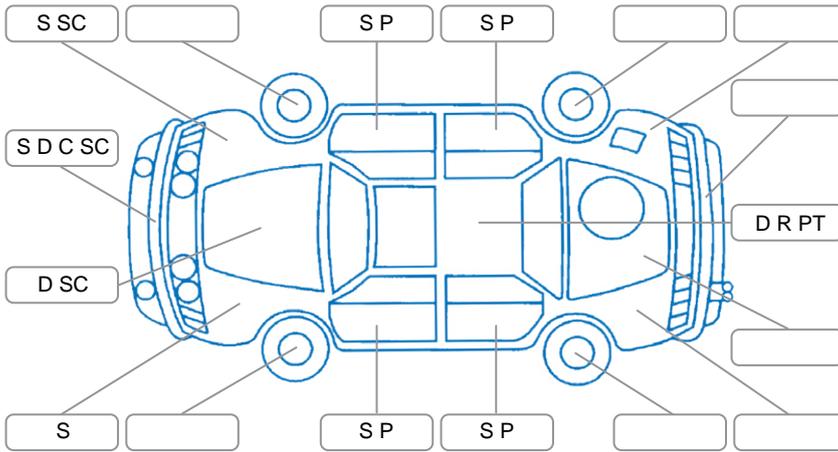

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

R sill panel scratches, centre airvent damaged, steering wheel worn, dashboard centre console has aftermarket holes, roof headliner stains, FB grille lower cracked

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

4WD
 Surface rust underside, engine oil leak/stains

Interior Comments

Seats:	driver seat torn
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Windscreen stonechip in & out of cva, service overdue, L running board dent

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Unknown
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Arunachalam Subramanian
Published by:	Darryl Kereti
Inspection Date:	09 Feb 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6.0 mm
Right front			8.0 mm
Left rear			8.5 mm
Right rear			8.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors			✓
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____