


Make:	Toyota	Model:	Landcruiser Prado
Body Style:	Wagon	Year:	1999
Rego No.:	EHQ504	Rego Expiry:	23 Dec 2025
WoF Expiry:	04 Aug 2026	Odometer:	395,060 Kms
Good No.:	27945523	VIN:	7A8H60H0708117883
Next Service:	404,500kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

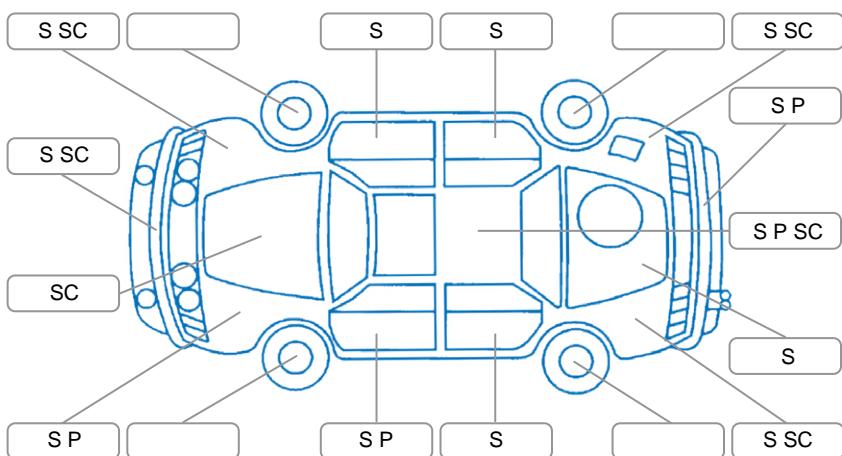

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Right front indicator lens cracked. Aerial cable broken.
 Spot lights removed.
 Rusty chips & scratches on roof.
 Rear reverse mirror missing. One wheel centre cap missing.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Engine oil leaks.

Interior Comments

Seats: 3rd row seats removed. 1 Rear headrest missing.
 Carpets: Average
 Panels: Average
 Dashboard: Left vent grille broken.

General Comments

A/C not cooling down.
 4x4 diesel auto SUV.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 300,136 Kms
Inspected by:	Daryl Timms
Published by:	Leon Sun
Inspection Date:	30 Jan 2026

I have read and understood
 this condition guide:

NAME _____

Report ID:	27,945,523	Version:	2
Created:	09 Feb 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	2.0	mm	
Right front	2.0	mm	
Left rear	5.0	mm	
Right rear	5.0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE _____