


Make:	Great Wall	Model:	V-Series
Body Style:	Utility	Year:	2013
Rego No.:	NJE1	Rego Expiry:	28 Jan 2027
WoF Expiry:	28 Jan 2027	Odometer:	145,934 Kms
Good No.:	27955109	VIN:	LGWCB317XDC647313
Next Service:	Unknown	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

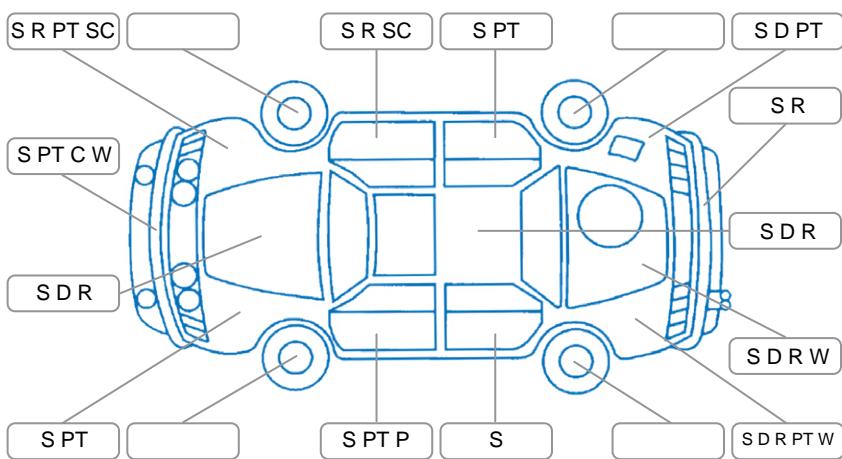

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Headlights Faded  
 Tailgate Jammed  
 No Jack or Tools  
 Mirror Detached from Windscreen - Requires Replacement Windscreen

Conditions During Body Inspection    Wet

**Under Carriage and Under Bonnet Inspection Comments**

Oil Leak  
 Water for Coolant  
 Underbody Surface Rust

**Interior Comments**

Seats:	Poor
Carpets:	Poor
Panels:	Average
Dashboard:	Average

**General Comments**

Fog Lights Not Working  
 Central Locking - Not Working on Right Rear Door

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Inspected by:	Samuel Weir
Published by:	James Scott
Inspection Date:	03 Feb 2026

I have read and understood  
 this condition guide:

NAME \_\_\_\_\_

Report ID:	27,955,109	Version:	3
Created:	11 Feb 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	2.5 mm		
Right front	4.0 mm		
Left rear	9.0 mm		
Right rear	8.5 mm		
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	1		
Central locking		✓	
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE \_\_\_\_\_