


Make:	Daihatsu	Model:	Sirion
Body Style:	Hatchback	Year:	2008
Rego No.:	ELD689	Rego Expiry:	25 May 2026
WoF Expiry:	30 Dec 2026	Odometer:	240,760 Kms
Good No.:	27964038	VIN:	JDAM301S001086707
Next Service:		Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

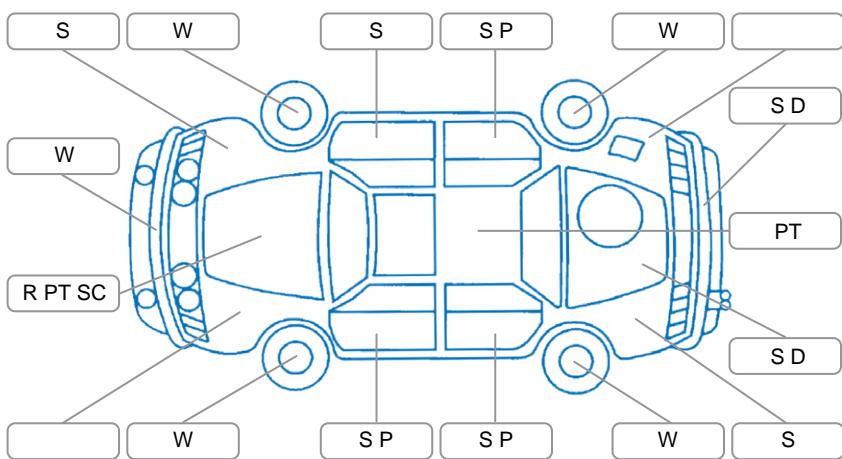

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Corrosion under bonnet  
 Dent and rust left sill panel  
 Corrosion behind tailgate and in spare wheel well  
 Underbody corrosion

**Conditions During Body Inspection**

**Under Carriage and Under Bonnet Inspection Comments**

Oil leaks  
 Right outer cv boot split

**Interior Comments**

Seats: Average  
 Carpets: Average  
 Panels: Average  
 Dashboard: Average

**General Comments**

Key fob broken and not working  
 Engine warning light displayed

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No
Inspected by:	Phillip Russel-Waimotu
Published by:	Phillip Russel-Waimotu
Inspection Date:	05 Feb 2026

I have read and understood  
 this condition guide:

NAME \_\_\_\_\_

Report ID:	27,964,038	Version:	1
Created:	05 Feb 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front		5 mm	
Right front		5 mm	
Left rear		6 mm	
Right rear		6 mm	
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE \_\_\_\_\_