


Make:	Toyota	Model:	Hilux
Body Style:	Utility	Year:	2010
Rego No.:	QEHB789	Rego Expiry:	27 Oct 2026
WoF Expiry:	04 Sep 2026	Odometer:	409,078 Kms
Good No.:	27967123	VIN:	MR0FZ22G001029483
Next Service:	419,000kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

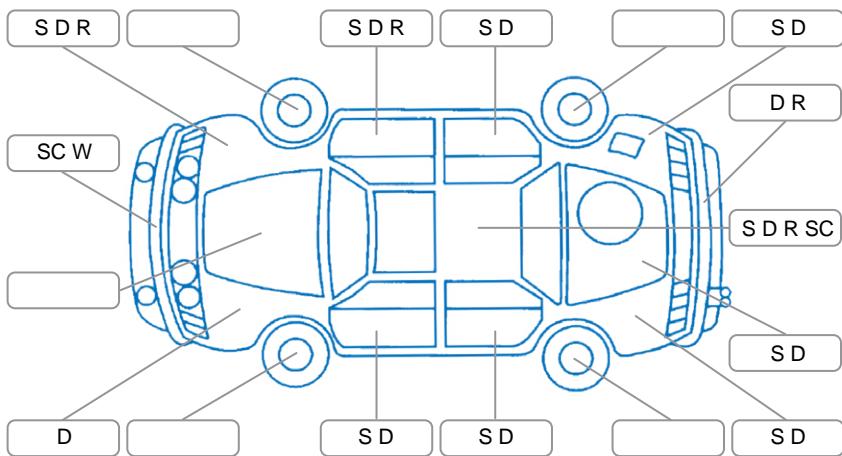

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Front bumper right spotlight plug is missing. Rear bumper step plate is missing.

Conditions During Body Inspection	Dry
-----------------------------------	-----

**Under Carriage and Under Bonnet Inspection Comments**

Leaking from right rear axle seal. Weeping from transmission.

**Interior Comments**

Seats: Side of right front base pad is torn.

Carpets: Average

Panels: Average

Dashboard: Average

**General Comments**

Left drink holder is broken. Left survivor vanity mirror came off. Canopy window locks are faulty. Canopy rear door glass is missing. Horn is not operating.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No    301,805 Kms
Inspected by:	Yuki Itohara
Published by:	Tiaan Pienaar
Inspection Date:	09 Feb 2026

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

Report ID:	27,967,123	Version:	1
Created:	10 Feb 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	3.0	mm	
Right front	3.0	mm	
Left rear	9.0	mm	
Right rear	9.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE \_\_\_\_\_