


Make:	Nissan	Model:	Note
Body Style:	Hatchback	Year:	2008
Rego No.:	LTC963	Rego Expiry:	21 Apr 2026
WoF Expiry:	11 Oct 2026	Odometer:	199,826 Kms
Good No.:	27968279	VIN:	7AT0DH79X18357081
Next Service:	207,450 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

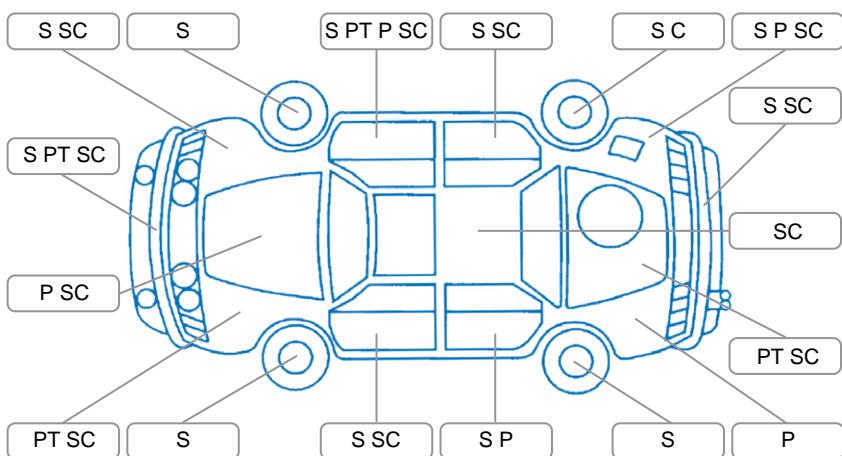

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Paint defect on RH side mirror.  
 RH tailgate strut removed and hinge damaged. Tailgate doesn't hold itself up.  
 FR sill step plate worn.  
 RH sill dented.

Conditions During Body Inspection	Dry
-----------------------------------	-----

**Under Carriage and Under Bonnet Inspection Comments**
**Interior Comments**

Seats:	Average, burn holes in passenger seat.
Carpets:	Average
Panels:	Average
Dashboard:	Good. Steering wheel wearing.

**General Comments**

Rear windows not working from door switches. FL window not going up from door switch.  
 Rear window wiper blade needs replaced.  
 One key remote missing bottom moulding.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No
Inspected by:	Troy Smith
Published by:	Troy Smith
Inspection Date:	10 Feb 2026

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

Report ID:	27,968,279	Version:	1
Created:	10 Feb 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	5.5 mm		
Right front	2.5 mm		
Left rear	4 mm		
Right rear	2.5 mm		
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL			✓
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE \_\_\_\_\_