


| | | | |
|------------|-------------|----------|---|
| Report ID: | 27,969,695 | Version: | 1 |
| Created: | 19 Feb 2026 | | |

| | | | |
|---------------|-------------|------------------|------------------|
| Make: | Honda | Model: | Elyson |
| Body Style: | Wagon | Year: | 2006 |
| Rego No.: | KLP830 | Rego Expiry: | 02 Mar 2026 |
| WoF Expiry: | 22 Oct 2026 | Odometer: | 221,451 Kms |
| Good No.: | 27969695 | VIN: | 7AT08GPX17115857 |
| Next Service: | 227,969 kms | Service History: | No |

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

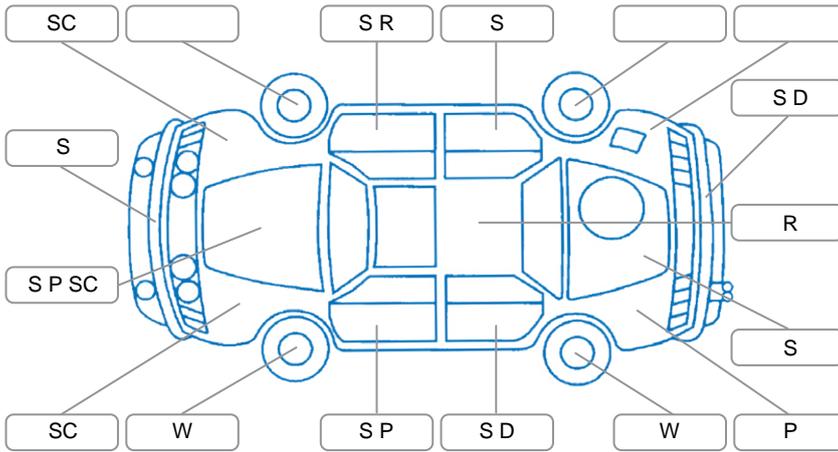

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

- Rear view mirror driver side close control not responding for FR mirror
- FR door interior seal torn
- Headlights faded
- FL door hinge creaking

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

- Fwd
- Engine oil leak
- Transmission oil seepage

Interior Comments

| | |
|------------|----------------------------------|
| Seats: | Good |
| Carpets: | Good |
| Panels: | Tailgate interior trim scratches |
| Dashboard: | Cracked |

General Comments

- Infotainment system not working
- Front fog lamps cracked

| | |
|-----------------------------------|---|
| Road Conditions During Test Drive | Dry |
| Engine Timing Mechanism | Timing Chain |
| Evidence of Cam Belt Replacement | <input type="checkbox"/> Yes <input type="checkbox"/> No Kms |
| Inspected by: | Vasanthakumar Mayilswamy |
| Published by: | Vasanthakumar Mayilswamy |
| Inspection Date: | 19 Feb 2026 |

| | OK | Requires Attention | N/A |
|---|----|--------------------|------|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Engine performance | ✓ | | |
| Noise | ✓ | | |
| Coolant condition | ✓ | | |
| Cooling performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | | | 7 mm |
| Right front | | | 7 mm |
| Left rear | | | 7 mm |
| Right rear | | | 7 mm |
| Spare | | Yes | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | | ✓ | |
| CD (basic test only) | | ✓ | |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. nav. (basic test only) | | | ✓ |
| Reversing camera | | ✓ | |

I have read and understood this condition guide:

NAME _____

SIGNATURE _____