

Report ID:	27,982,639	Version:	1
Created:	19 Feb 2026		


Make:	Toyota	Model:	Landcruiser
Body Style:	Wagon	Year:	1993
Rego No.:	BAY695	Rego Expiry:	27 Mar 2026
WoF Expiry:	05 Aug 2026	Odometer:	169,796 Kms
Good No.:	27982639	VIN:	7A8H60H0702002377
Next Service:	unknown	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

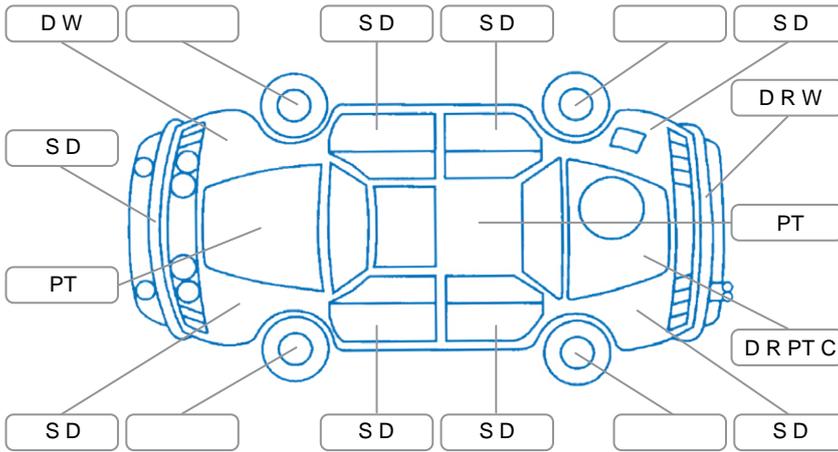

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Left front guard corner mirror is missing. Aerial is broken.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

AC has been removed.

Interior Comments

Seats:	Side of right front base pad is worn ,torn.
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Driver's seat belt had been repaired and sensor is not connected to new buckle(possibly incorrect way),also has minor damage. Leaking from engine. Right rear wiper is not operating. Rear wiper washer is not operating.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Yuki Itohara
Published by:	Glen Charlton
Inspection Date:	19 Feb 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch		✓	
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.0 mm
Right front			5.0 mm
Left rear			6.0 mm
Right rear			6.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____