


Report ID:	27,987,327	Version:	3
Created:	26 Feb 2026		

Make:	BMW	Model:	318I CON
Body Style:	Convertible	Year:	1991
Rego No.:	GMF547	Rego Expiry:	
WoF Expiry:	29 Jul 2022	Odometer:	220,122 Kms
Good No.:	27987327	VIN:	WBABA52090EJ35574
Next Service:	226000 kms	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

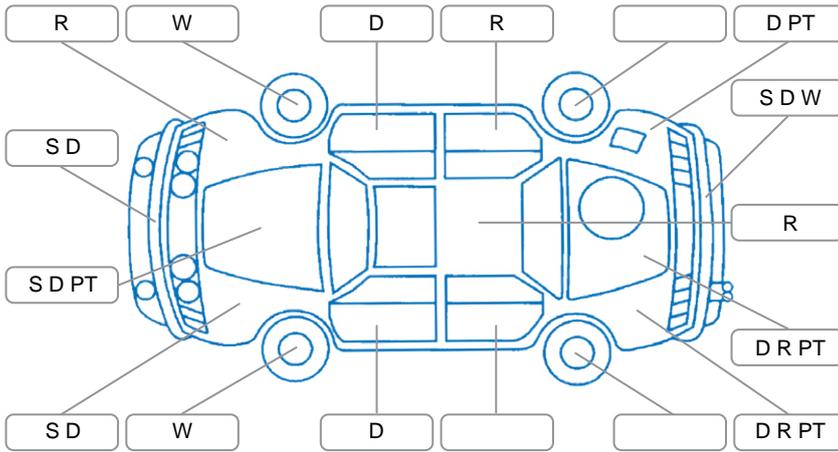

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Both front tail light damage and cracked, windscreen cracked, exterior body rust, engine oil leak, steering rock play, leak and boot split, flat battery, rear differential leak, shock lower spring noise when driving underneath, all brake rotor rust,

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	cracking

General Comments

Driver seat torn, both front seat underneath rust, brake booster rust, rear view mirror re fit, dashboard cracked, washer jet block,

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Marlon Espena
Published by:	Marlon Espena
Inspection Date:	26 Feb 2026

	OK	Requires Attention	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Engine performance		✓	
Noise		✓	
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance		✓	
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5 mm
Right front			5 mm
Left rear			4 mm
Right rear			4 mm
Spare			
Suspension			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking			✓
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____