

Report ID:	28,000,684	Version:	1
Created:	10 Mar 2026		


Make:	Toyota	Model:	Altezza
Body Style:	Sedan	Year:	1999
Rego No.:	QCL332	Rego Expiry:	20 Dec 2026
WoF Expiry:	22 Jun 2026	Odometer:	117,755 Kms
Good No.:	28000684	VIN:	7AT0H639X20025346
Next Service:	No recent service or history.	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

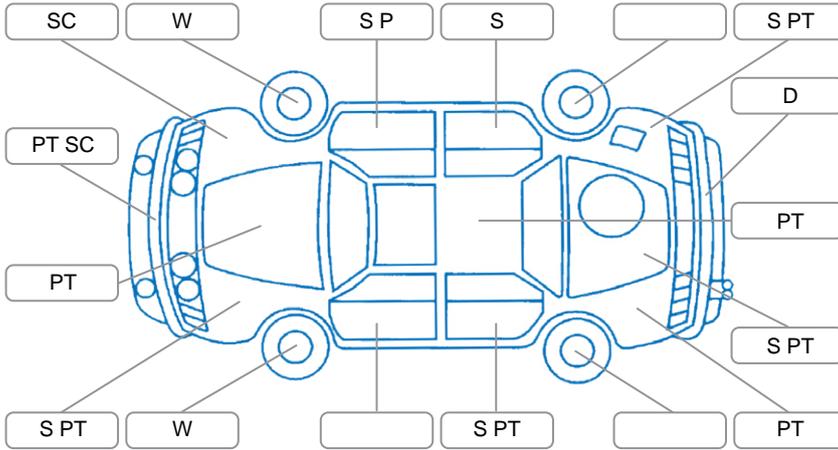

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Clear coat deteriorating over majority of car and big dent in rear bumper. LH rear taillight and bumper loose/ out of alignment.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Bonnet strut holder broken.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Good

General Comments

Vehicle drove well.
 Right number plate light not working.
 1 key ignition one for central locking.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms

Inspected by:	Aaron Johnson
Published by:	Aaron Johnson
Inspection Date:	10 Mar 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6 mm
Right front			6 mm
Left rear			5 mm
Right rear			5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____