

Report ID:	28,006,437	Version:	2
Created:	25 Feb 2026		


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2015
Rego No.:	HZD158	Rego Expiry:	11 Mar 2027
WoF Expiry:	11 Feb 2027	Odometer:	281,636 Kms
Good No.:	28006437	VIN:	MMAENKB40FD023236
Next Service:	287,000kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

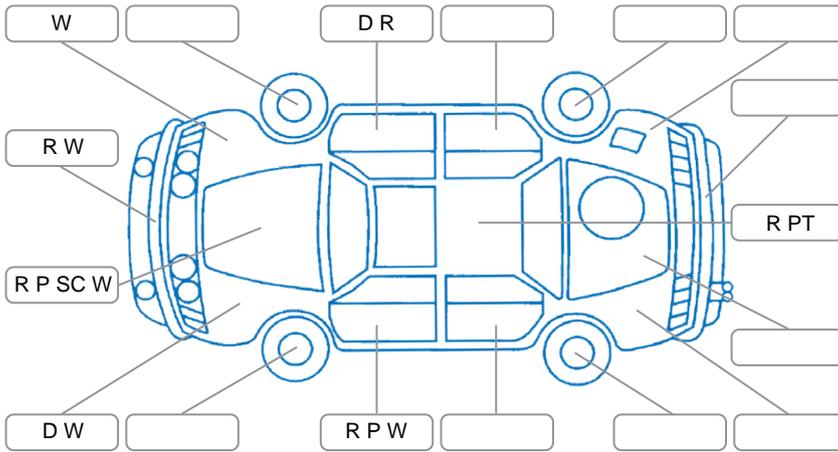

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Right taillight crack
 Both sill rust & dent
 Right B pillar scratch / Left B pillar rust
 Average damage on tray / Rust on tray

Conditions During Body Inspection: Wet Dry

Under Carriage and Under Bonnet Inspection Comments

Oil leak (requires further investigation)
 Suspected rear diff leak (requires further investigation)
 Underbody surface rust
 Front left inner CV boot leak

Interior Comments

Seats:	ripped
Carpets:	ripped drivers well
Panels:	Average
Dashboard:	holes in dashboard

General Comments

Partial service history
 Worn clutch
 One key remote not operating

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Unknown
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Kilipati Mae
Published by:	Bruce Sreaton
Inspection Date:	24 Feb 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch		✓	
CV joints		✓	
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			5.0 mm
Left rear			4.0 mm
Right rear			3.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____