

Report ID:	28,013,056	Version:	1
Created:	06 Mar 2026		


Make:	Honda	Model:	CRV
Body Style:	Wagon	Year:	2007
Rego No.:	GUG576	Rego Expiry:	21 Apr 2026
WoF Expiry:	12 Dec 2026	Odometer:	311,000 Kms
Good No.:	28013056	VIN:	7AT08G7HX12009827
Next Service:	301,000km's	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

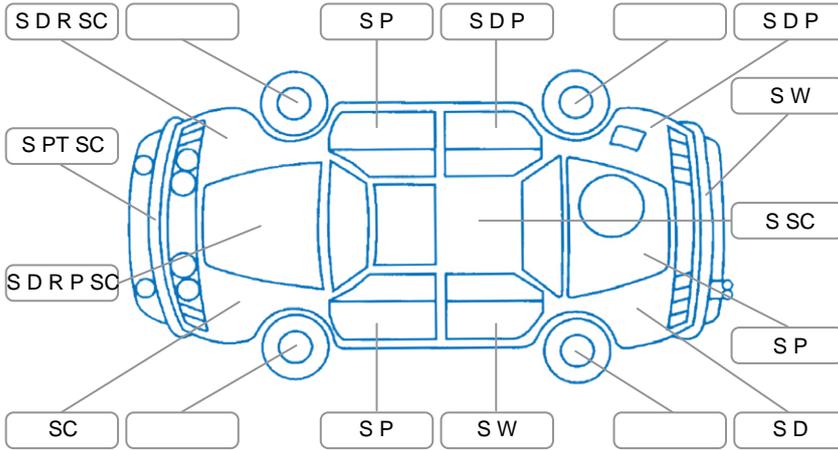

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Heavy stone chipping across windscreen & front bonnet. Front spot lights are not working & both lenses are cracked & broken. Left rear corner of rear bumper is not fitting correctly to rear guard.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Power steering pump is starting to get a bit noisy.

Interior Comments

Seats:	Good
Carpets:	Average
Panels:	Average
Dashboard:	Good

General Comments

Correct km's are 309,955km's. Engine oil service is overdue. Radio face fold open button cover is missing off front of radio, button still works. Left rear seat belt trim cover missing off bolt on rear C pillar.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Timing Chain	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No	Kms
Inspected by:	Jason Young	
Published by:	Glen Charlton	
Inspection Date:	04 Mar 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.0 mm
Right front			4.0 mm
Left rear			3.4 mm
Right rear			6.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____