


Report ID:	28,019,320	Version:	1
Created:	06 Mar 2026		

Make:	Mitsubishi	Model:	L300
Body Style:	Van	Year:	2014
Rego No.:	HRJ854	Rego Expiry:	18 Dec 2026
WoF Expiry:	17 Dec 2026	Odometer:	174,997 Kms
Good No.:	28019320	VIN:	JMAHNP14VDA801049
Next Service:	184,000kms	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

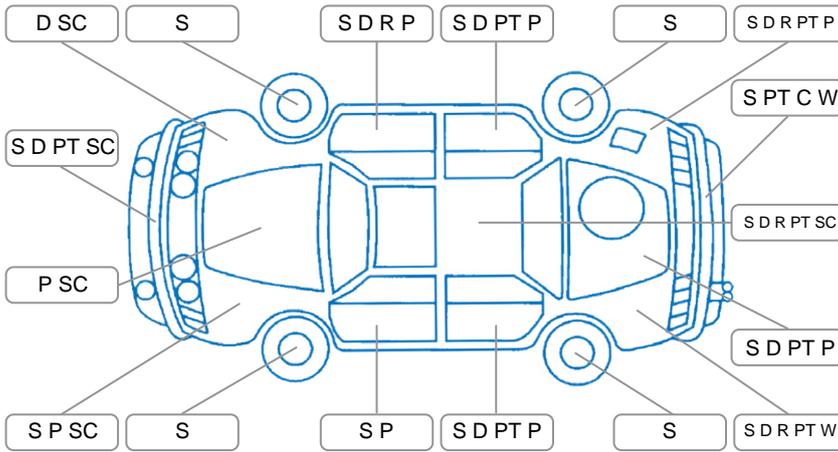

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Poor panel & paint repair to left side rear door, left rear van side body panel, rear tailgate, right rear van side body panel & right side rear door. Water inside right front indicator lens. Outside edge worn down to cords on left front tyre, needs replaced.

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

Oil leak from engine. Developing underbody surface rust.

Interior Comments

Seats:	Average
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Large hole in fabric & foam missing out of base pad on driver's seat, hole in fabric on left side seat base pad. Cd player is not working. Left front door lock is damaged. Horn is sometimes not working when you push it.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 100,771 Kms
Inspected by:	Jason Young
Published by:	Callum Busuttill
Inspection Date:	04 Mar 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			0.0 mm
Right front			6.0 mm
Left rear			5.0 mm
Right rear			5.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking			✓
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____