

Report ID:	28,027,736	Version:	1
Created:	12 Mar 2026		


Make:	Daihatsu	Model:	Sirion
Body Style:	Hatchback	Year:	2006
Rego No.:	DJN971	Rego Expiry:	19 Dec 2026
WoF Expiry:	16 May 2026	Odometer:	108,489 Kms
Good No.:	28027736	VIN:	JDAM301S001036266
Next Service:	27/05/2024	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

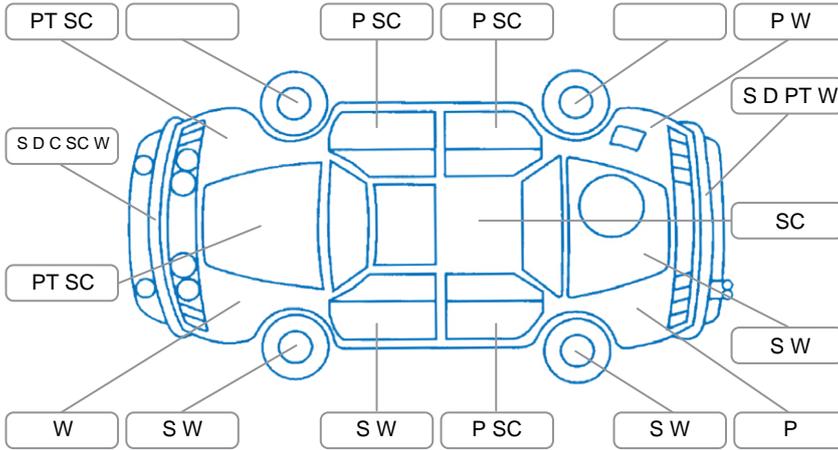

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Front bump has a significant dent, will also need to be refitted

Conditions During Body Inspection

Dry

**Under Carriage and Under Bonnet Inspection Comments**

Service is due  
 Recommend replacing drive belt  
 Rocker cover showing signs of leaking  
 Battery needs to be replaced

**Interior Comments**

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

**General Comments**

Front wheel drivee  
 Steering pulls to the left - recommend a wheel alignment  
 Driver side window doesn't work as the switch is loose.  
 Handbrake lever button is broken

Road Conditions During Test Drive    Dry

Engine Timing Mechanism    Unknown

Evidence of Cam Belt Replacement     Yes     No    Kms

Inspected by: Bobby Zhong

Published by: Bobby Zhong

Inspection Date: 12 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5 mm
Right front			5 mm
Left rear			7 mm
Right rear			7 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR		✓	
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys		2	
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_