

Report ID:	28,033,429	Version:	1
Created:	10 Mar 2026		


Make:	Toyota	Model:	Hilux
Body Style:	Utility	Year:	2010
Rego No.:	FPT112	Rego Expiry:	27 Oct 2026
WoF Expiry:	05 Sep 2026	Odometer:	274,423 Kms
Good No.:	28033429	VIN:	MR0FZ29G101602235
Next Service:	283,000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

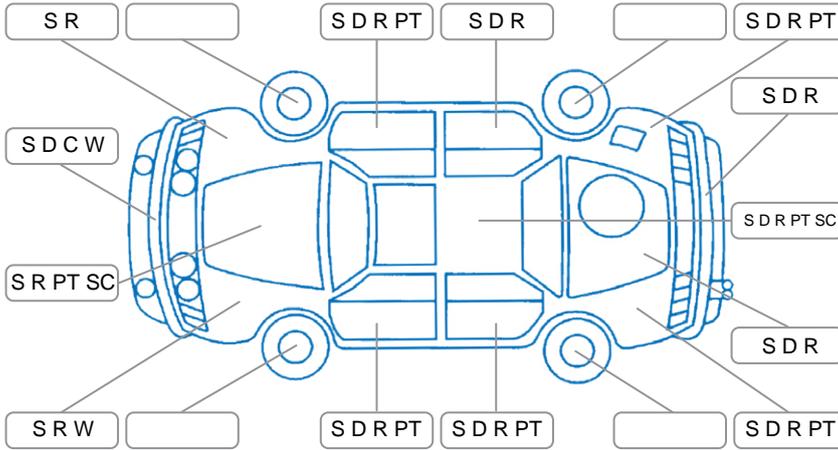

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

No jack or tools. Holes in left inner guard. Upper grille popped out. Left step dented, right step missing. Headlights yellow. Stone chips in windscreen. Paint worn in door sills. Dents in roof & back of cab. Taillights cracked. Tailgate stuck shut.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Rust under battery tray. Extensive underbody surface rust. Fluid leak.

Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Poor
Dashboard:	Poor

General Comments

Climate temperature knob broken & missing
 Security message on radio, can be bypassed with mode button on steering wheel

Play in steering. Slight transmission whine

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 269,073 Kms
Inspected by:	Samuel Weir
Published by:	Darren Beban
Inspection Date:	09 Mar 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise		✓	
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6.5 mm
Right front			6.5 mm
Left rear			6.5 mm
Right rear			5.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____