

Report ID:	28,046,147	Version:	1
Created:	16 Mar 2026		


Make:	BMW	Model:	120i
Body Style:	Hatchback	Year:	2008
Rego No.:	HYK753	Rego Expiry:	08 Jul 2026
WoF Expiry:	03 Feb 2027	Odometer:	140,477 Kms
Good No.:	28046147	VIN:	WBAUD320X0PF45506
Next Service:	148,000 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

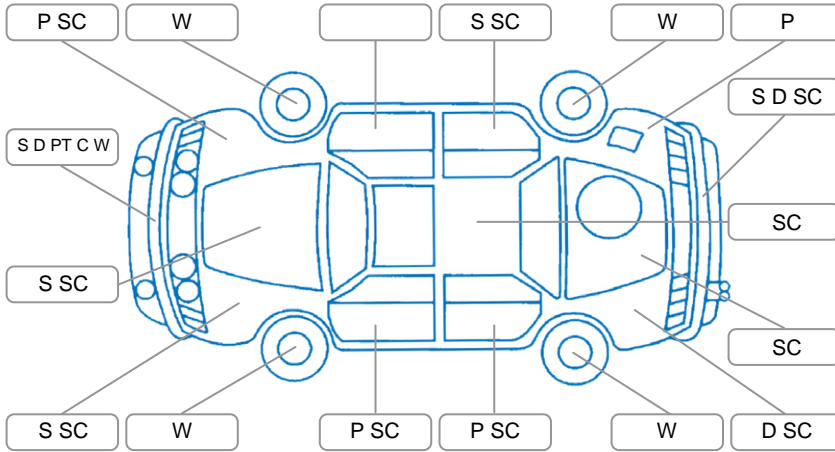

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Damage on front bumper taped over. Rear bumper left side trim held on with tape

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

2WD

Engine oil weep and seepage

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Left rear window faulty
 Interior roof lining sagging
 Electronic oil level reader possibly faulty. Stated to top up 1 litre of oil, topped up oil and reader still saying to top up 1 litre. Service was only recently done 2,000 Kms ago.

Road Conditions During Test Drive

Dry

Engine Timing Mechanism

Timing Chain

Evidence of Cam Belt Replacement

Yes No

Kms

Inspected by: Ryan Scott

Published by: Malcolm Thomas

Inspection Date: 12 Mar 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.8 mm
Right front			4.7 mm
Left rear			1.9 mm
Right rear			2.8 mm
Spare		N/A	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL		✓	
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____