


| | | | |
|------------|-------------|----------|---|
| Report ID: | 28,048,447 | Version: | 2 |
| Created: | 16 Mar 2026 | | |

| | | | |
|---------------|-------------|------------------|-------------------|
| Make: | Mitsubishi | Model: | Outlander |
| Body Style: | Wagon | Year: | 2006 |
| Rego No.: | MWD521 | Rego Expiry: | 01 Nov 2026 |
| WoF Expiry: | 01 Nov 2026 | Odometer: | 177,156 Kms |
| Good No.: | 28048447 | VIN: | 7AT0CJ3MX18010438 |
| Next Service: | 182,000 Kms | Service History: | No |

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

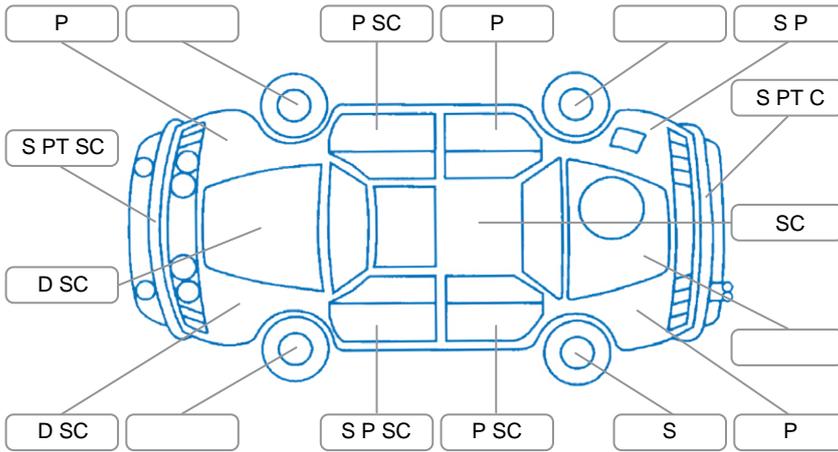

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Front bumper fits poorly. Missing tools.
 RH side mirror scuffed. Aerial in poor condition.
 Rear wiper missing blade tailgate window scratched by wiper.
 Rear bumper valance fits poorly on RH side. RH sill dented and gouged.

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

Coolant level very low at time of inspection, coolant very foamy when topped up, suspect additive in cooling system.
 Coolant leak. Both front inner CV boots split. Front suspension rattle.
 Engine oil leak. Minor undercarriage surface rust. Brakes pulsating.

Interior Comments

| | |
|------------|--|
| Seats: | Good |
| Carpets: | Average, wearing in drivers footwell. |
| Panels: | Average, centre console lid loose. Door cards worn |
| Dashboard: | Good |

General Comments

Third row seat mechanism covers missing, springs exposed. Front window washers need adjusted. Drivers seat height adjustment handle broken.
 Steering wheel not straight when driving straight.
 Ignition dummy broken, key blade needed to turn ignition.

| | | |
|-----------------------------------|--|-----|
| Road Conditions During Test Drive | Dry | |
| Engine Timing Mechanism | Timing Chain | |
| Evidence of Cam Belt Replacement | <input type="checkbox"/> Yes <input type="checkbox"/> No | Kms |
| Inspected by: | Troy Smith | |
| Published by: | Troy Smith | |
| Inspection Date: | 16 Mar 2026 | |

| | OK | Requires Attention | N/A |
|---|----|--------------------|------|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Engine performance | ✓ | | |
| Noise | ✓ | | |
| Coolant condition | | ✓ | |
| Cooling performance | ✓ | | |
| Radiator / Hoses (visual) | | ✓ | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | | ✓ | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | | ✓ | |
| Hand brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | | | 5 mm |
| Right front | | | 4 mm |
| Left rear | | | 7 mm |
| Right rear | | | 6 mm |
| Spare | | Yes | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | | ✓ | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

I have read and understood this condition guide:

NAME _____

SIGNATURE _____