

Report ID:	28,051,751	Version:	2
Created:	19 Mar 2026		


Make:	Volvo	Model:	V50
Body Style:	Wagon	Year:	2006
Rego No.:	DHM33	Rego Expiry:	10 Oct 2026
WoF Expiry:	12 Sep 2026	Odometer:	234,461 Kms
Good No.:	28051751	VIN:	YV1MW384962185328
Next Service:	231,720 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

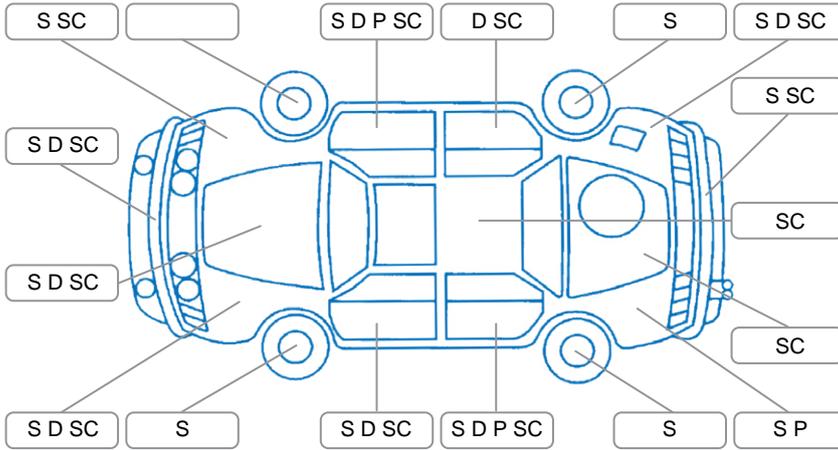

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Paint defect on side mirrors.  
 Stonechips/crack in windscreen.  
 RF tyre worn on inside edge.

Conditions During Body Inspection    Dry

### Under Carriage and Under Bonnet Inspection Comments

Window washer reservoir mount broken.  
 LH inner CV boot split.  
 Engine oil leaks.  
 Engine undertrays loose.

### Interior Comments

Seats: Average, drivers seat leather torn.  
 Carpets: Good  
 Panels: Poor, door card fabrics and headliner sagging.  
 Dashboard: Average, steering wheel worn.

### General Comments

LF window washer spray nozzle missing, rear window washer not spraying.  
 LH low beam not working, warning on dash.  
 Service due message on dash.  
 Noise in pulley area.                      Brakes are pulsating.

Road Conditions During Test Drive    Dry

Engine Timing Mechanism    Cambelt

Evidence of Cam Belt Replacement     Yes     No    118,000 Kms

Inspected by: Troy Smith

Published by: Troy Smith

Inspection Date: 19 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			4.5 mm
Right front			3.5 mm
Left rear			4.5 mm
Right rear			5.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_